C/007/012 Incoming #4253



### MT NEBO SCIENTIFIC, INC.

research & consulting

VIA: <u>U.S. Priority Mail</u> January 31, 2013

April Abate, Team Lead
Utah Coal Regulatory Program
STATE OF UTAH
Division of Oil, Gas & Mining
1594 West North Temple, Suite 1210
Salt Lake City, Utah 84114-5801

RECEIVED

DIV. OF OIL, GAS & MINING

RE: Wellington C/007/012: Midterm Review Responses (Round 2)

Dear Ms. Abate:

A response to the Division's Midterm Review for the Wellington Preparation Plant was provided to you earlier – it was dated November 20, 2012. After the review, the Division requested additional information, mostly regarding reclamation costs at the site.

Attached please find three (3) copies of NEICO's responses. All redline/strikeout markings have been retained in this submittal, along with the footer date (11/20/12). To distinguish between the two submittals, the changes are blue-colored.

The documents have basically been divided into two sections. This first section, \*\*DEFICIENCIES & NEICO COMMENTS\*\*, cites each deficiency and provides comments about the methodologies or background information about each response. The section is not intended to be inserted in the MRP. The next section, \*\*DEFICIENCIES & MRP INSERTION INSTRUCTIONS\*\*, again cites each deficiency and provides instructions for each response to be inserted in the MRP.

Thank you for your help in this process.

Sincerely,

Patrick D. Collins, Ph.D.

Resident Agent

Attachments

cc: T. Garcia (NEICO)


File in:

☐ Confidential

Shelf

☐ Expandabl

Date Folder 00015 C/O

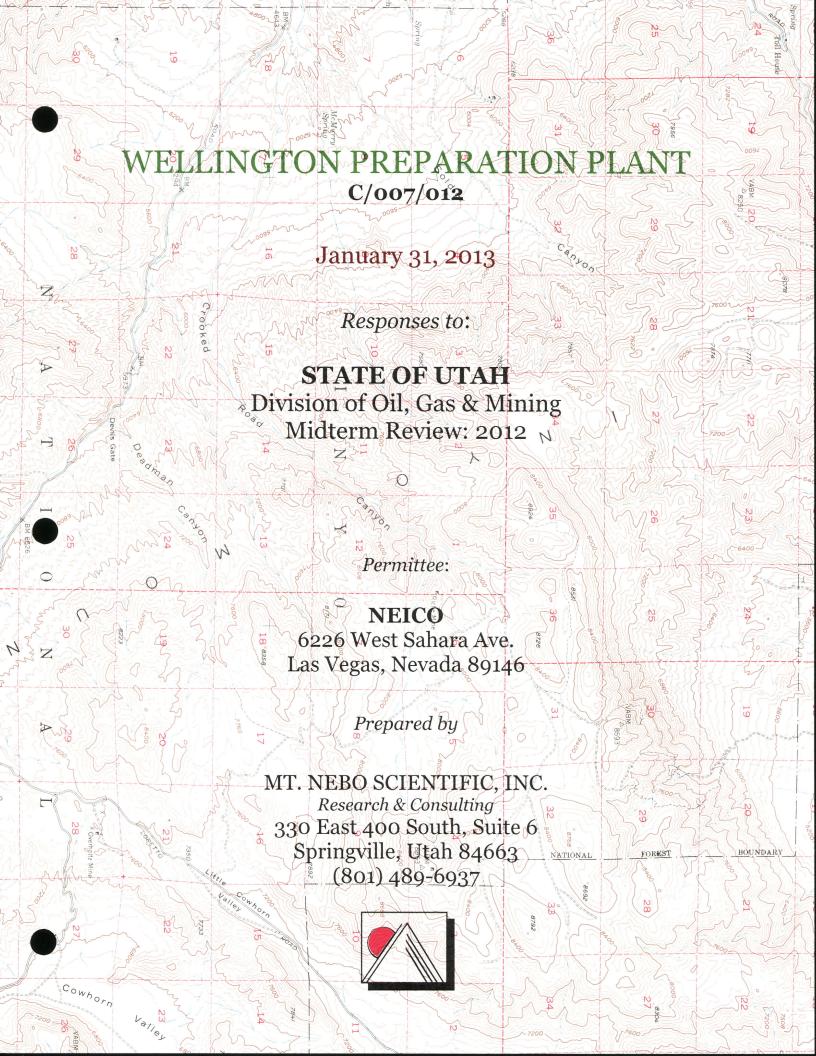

## APPLICATION FOR COAL PERMIT PROCESSING

Permit Change   New Permit  Renewal  Exploration  Bond Release  Transfer   Transfer					
Permittee:				C/007/012	
Mine:	Wellington Preparation Plant		Number: [		
	Title: Responses to State of Utah, Division of Oil, Gas & Mining Midterm Review: 2012 (Submittal Date: January 31, 2012)				
•	, Include reason for application and timing required to implement:	de de la completa de Dist	••••		
	Midterm Review by the Division. (Implement timing when approp				
Yes No	s: If you answer yes to any of the first eight questions, this apple 1. Change in the size of the Permit Area? Acres:			increase decrease.	
Yes X No	2. Is the application submitted as a result of a Division Ore	der? DO#		merease decrease.	
Yes X No	3. Does the application include operations outside a previous	ously identified Cumu			
Yes X No					
Yes No			nce or reclam	ation bond?	
Yes X N			compliance in	nformation?	
Yes X N	8. Is proposed activity within 100 feet of a public road or				
Yes X N				The state of the s	
Yes X N	Explain:	regulations or policie	·s?		
☐ Yes 🛛 N					
Yes X N					
Yes X N					
Yes X N					
Yes X N					
Yes X N					
Yes No	<ul> <li>18. Does the application require or include water monitoring</li> <li>19. Does the application require or include certified design.</li> </ul>			easures?	
Yes X N			1.		
X Yes N	o 21. Have reclamation costs for bonding been provided?				
Yes X N					
	<ul> <li>23. Does the application affect permits issued by other age</li> <li>24. Does the application include confidential information a</li> </ul>				
	three (3) review copies of the application. If the mine is on				
	ank you. (These numbers include a copy for the Price Field Office)	\(\)		<b>P</b> • • • • • • • • • • • • • • • • • • •	
71 1 .:		1: 1: 1: 1: 1: 1: 1: 1: 1: 1: 1: 1: 1: 1	A . /	ha ha a fara in faranchian	
and belief in all	hat I am a responsible official of the applicant and that the information contain respects with the laws of Utah in reference to commitments, undertakings, and	obligations, hereigh.	e and gorrect to t	ne best of my information	
Patrick D. C		Patale (1	ML		
Print Name					
Subscribed and s	sworn to before me this 30 day of January, 2013		MARCIE	S. CLARK	
Notary Public: Marcie St. Clark, state of Utah.					
_	(1)1/11/			ON# 583091	
My commission Commission Nu	Expires.	The state of the s	COMM. EXI		
Address: 1/0 5 - Main					
City: Springville State: LT Zip: 84663					
For Office Us	e Only:	Assigned Tracking	Received	by Oil, Gas & Mining	
		Number:	6	RECEIVED	
			F	EB 0 5 2013	
			DIV.O	FOIL, GAS & MINING	

# APPLICATION FOR COAL PERMIT PROCESSING Detailed Schedule Of Changes to the Mining And Reclamation Plan

Permittee:	NEICO			. Г	
Mine:		Wellington Preparation Plant Permit		Number:	C/007/012
Title:	Responses	nses to State of Utah, Division of Oil, Gas & Mining Midterm Review: 2012 (Submittal Date: January 31, 2012)			
Provide a detailed listing of all changes to the Mining and Reclamation Plan, which is required as a result of this proposed permit application. Individually list all maps and drawings that are added, replaced, or removed from the plan. Include changes to the table of contents, section of the plan, or other information as needed to specifically locate, identify and revise the existing Mining and Reclamation Plan. Include page, section and drawing number as part of the description.					
			DESCRIPTION OF MAP, TEXT, OR MATERIA		
X Add	Replace		Refer to the attached "DEFICIENCIES & MRP INSERTION AND ASSESTED ASSESSED IN THE REPORT OF THE PROPERTY OF THE	ON INSTRU	CTIONS"
	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace	Remove			
Add	Replace				
Add	Replace	Remove			
Add	Replace	Remove			
	Replace	Remove			,
	Replace	Remove			
			on required for insertion of this proposal into the	Received b	y Oil, Gas & Mining
Mining and	Reclamatio	n Plan.			
				R	ECEIVED
				FE	B 0 5 2013
				DIV. OF	OIL, GAS & MINING
					The state of the s

## DEFICIENCIES

## &

## NEICO COMMENTS

Task No. 4043

Task Name: 2012 Midterm Permit Review

The members of the Division's review team include the following individuals: April Abate (AA)
Priscilla Burton (PB)
Ingrid Campbell (IC)
Angela Nance (AN)
James Owen (JO)

**1.** [R645-301-113.300]: Violation Notices. The MRP lists the most recent update of the violations database in 2004. This information should be updated. (AA)

### **NEICO Comments:**

- There were several deficiencies in this section of Wellington's MRP pertaining to R645-301-100 in the regulations.
- When comparing the Division's copy of the MRP with *Mt. Nebo Scientific*'s office copy, it was apparent that the Division's copy is *outdated* in this chapter.
- With this in mind, a redline/strikeout version could not be prepared to address the
  Division's deficiencies because we would have been editing outdated information
  with the Division's copy or editing Mt. Nebo's copy making changes that would
  make no sense to the Division reviewers.
- Finally, because several deficiencies were written in this section of the MRP, with the exception of the attachments at the end, the entire chapter was revised to address the deficiencies as well as add other updated information.
- All deficiencies have been addressed. Insertion instructions for the MRP have been provided with the C1-C2 Forms.

**2.** R645-301-114.100]: Right of Entry. The ROE information provided in the section deals solely with the COVOL lease and their ROE agreement with NEICO. The remainder of the section includes the lease agreement between NEICO and COVOL. There was no information in this section discussing the legal right of entry for the Permittee themselves. This section should reference a deed and/or any other lease agreements that are in place for the Permittee to demonstrate legal ROE in order to comply with this regulation. (AA & PB)

- This deficiency was addressed in the information described in No. 1 above.
- Specifically, the information can be found in Section 1.20, p. 13, 11/20/12 in the attached information.

3. [R645-301-116.100]: Permit Term Information. The information regarding the permit term was last updated in 1994. If any information about the long-term operational plan for the site has changed, than that information should be updated in this section also. (AA)

#### **NEICO Comments:**

- This deficiency was addressed in the information described in No. 1 above.
- Specifically, the information can be found in Section 1.20, p. 15, 11/20/12 in the attached information.
- **4.** [R645-301-722.100]: Location and Extent of Ground Water. This section discusses the nature and extent of groundwater within the permit area. The section references Table 722-1 with water level readings collected in 1990. This table however, provides data current up through 1998. The table should be updated to include more recent groundwater gauging levels while preserving the historic data for comparison. The reference in the narrative text should also then be updated. (AA)

#### **NEICO Comments:**

- Table 7.22-1 has been updated to include recent water level data (2<sup>nd</sup> quarter 2012) for wells. Water levels were generally similar to previous values.
- **5.** [R645-301-722.400]: Location and Depth of Water Wells. This regulation is missing from the plan. Please add a reference to the map showing the locations of all groundwater monitoring wells and any other water wells within and adjacent to the permit area. A reference to the well location map and Table 7.22-1 should be referenced here. (AA)

#### **NEICO Comments:**

 A description for R645-301-722.400 has been added to the MRP. A reference to Table 7.22-1 was added. 6. [R645-301-723]: Sampling and Analysis. This section describes the water sampling plan for the site. This will likely be updated when the Probable Hydrologic Consequences (PHC) section of the plan gets updated. In addition, there is language in this section discussing COVOL's water monitoring responsibilities. This information should be updated. Furthermore, this section discusses the need to monitor groundwater for the presence of BTEXN and propylene glycol compounds. This action was based on the operational activities at the COVOL wash plant when additives were used in the coal washing process. Since these compounds were not detected in significant concentrations, continued monitoring no longer appears necessary. The language in this section should be updated to reflect the historic operations at the COVOL wash plan. (AA)

#### **NEICO Comments:**

- References to Covol's monitoring responsibilities have been removed from 301-723.
- Monitoring parameters BTEX-N and propylene glycol have been removed from the water monitoring plan for surface waters and ground waters.
- The language regarding BTEX-N and propylene glycol has been removed from several sections of Chapter 7

7. [R645-301-724]: Water Quality. This section references water quality data up through May 1997. This section summarizes the tabulated data found in Table 7.24.3. This information should all be updated based on the outcome of the PHC evaluation. The Permittee may want to consider consolidating some of these data tables or removing them altogether from the plan since this data is all available electronically through the Division's electronic water quality database. (AA)

#### **NEICO Comments:**

- Tables 7.24-3, 7.24-3a, 7.24-3b, and 7.24-3c have been removed from the MRP as this data is all available electronically through the Division's electronic water quality database.
- **8.** [R645-301-724.400]: Climatological Information. This section requires climatological information of the permit area. Seasonal temperature ranges were provided; however, seasonal precipitation ranges and prevailing wind direction and velocity information were not. The information provided in the MRP lists only the average annual precipitation total. Please provide seasonal precipitation averages, prevailing wind direction and velocity information. (AA)

#### **NEICO Comments:**

 Climatological information including seasonal precipitation ranges and regional prevailing wind direction and velocity was added to R645-301-724-400. **9.** [R645-301-724.600]: Survey of Renewable Resource Lands. This section discusses COVOL operations in the present tense and should be updated. (AA)

#### **NEICO Comments:**

 Information discussing COVOL's operations in the present tense were updated in R645-301-724.600

10. [R645-301-727]: Alternative Water Resource Information. This section discusses a water right held by the Permittee for water from the Price River. The section also discusses a lease agreement with COVOL. This section should now be updated to reflect historic water usage when COVOL operated their facility. Paragraph 3 also lists the State Department of Health as the regulatory authority over the Price River. This should be changed to the Utah Department of Environmental Quality. (AA)

#### **NEICO Comments:**

- R645-301-727 has been updated to reflect current conditions and preserve the historic water usage.
- The reference to the State Department of Health was corrected.

11. [R645-301-728]: Probable Hydrologic Consequences (PHC). Based on ongoing discussions with the Permittee and their hydrologic consultant, it was agreed that a revised PHC should be prepared for the site as part of the 2012 midterm permit review. (AA)

#### **NEICO Comments:**

- The statement of probable hydrologic consequences (PHC) has been updated.
- It should be noted that, because of uncertainties in the future ownership and operational status of the facility, some language regarding previous operational conditions and potential future operations was not removed from the MRP.

12. [R645-301-731.122 and -.222]: Water Monitoring. These sections should be updated based on the outcome of the revised PHC. (AA)

#### **NEICO Comments:**

• Sections R645-301-731.122 and .222 (water monitoring plans) were updated.

**13.** [R645-301-731.800]: Water Rights and Water Replacement. Information on the operational status of COVOL and its use of 5 cfs of water requires updating. (AA)

#### **NEICO Comments:**

 Section 731-800 was modified to reflect the potential historic use of 5 cfs at the Covol operation.

#### 14. [R645-301-733.220]: Permanent and Temporary Impoundments.

The MRP currently states that no permanent impoundments are proposed. Based on the midterm field visit, a discussion initiated with regard to the Dryer Pond indicating that it could be a candidate for a permanent impoundment given the continuous source of water being fed to it via a culvert. Alluvial water is contained in the impoundment creating a wetland feature of high esthetic value. The Division feels that the quality of the water in the impoundment meets the criteria set forth in 733.220 thru 733.226. The permanent wetland impoundment would have to be added to the reclamation plan and an application for a land-use change, should it be transferred to industrial use. (AA)

#### **NEICO Comments:**

- Thank you for your comments. We will take them into consideration and submit an amendment for a permit change when this decision is made by the Permittee.
- No change to the MRP on this subject has been prepared with this submittal.

**15.** [R645-301-121.100 & -521.165]: Label the topsoil stockpiles and include them in the legend on Facilities Map E9-3341. (PB)

#### **NEICO Comments:**

The topsoil stockpiles have been added to the Facilities Map E9-3341

**16.** [R645-301-121.100 & -112.600]: Update Surface ownership map Plate E9-3341 A and Section 112.600 of the MRP. (PB)

- A new Surface Ownership Map E9-3341 A has been created for the MRP
- Section 112.600 has also been updated (see Section 1.20, pp. 8-10, 11/20/12).

17. [R645-301-820.113]: Currently the Reclamation Agreement (dated 2000) references MRP Chap 1 Ex. A for the bonded area, which is the map included with the COVOL lease, is this reference still accurate? If not, please update the reference to the map illustrating the 392 bonded acres in the 2000 Reclamation Agreement. (Previous reclamation agreements have referred to Dwg. E9-3341 for the bonded/disturbed area. However Map E9-3341 shows a permit boundary that is significantly larger than 392 acres, but does not have a bonded/disturbed area boundary on the map or in the legend. (PB)

- Rather than changing a legal document that we did not prepare (Reclamation Agreement), we have addressed this deficiency in another area of the MRP.
- This deficiency was addressed in the information described in No. 1 above.
- Specifically, the information can be found in Section 1.00, p. 7, 11/20/12.

**18.** [R645-301-233.100]: The 2008 bond describes soil salvage from Areas E, D, H, & I. This will not result in the best available soil in the permit area being utilized. Rather Areas B & C are the most preferable, followed by shallow soils in Area D and G. Compare borrow areas shown on Plates E9-3341 and E9-3511 and make adjustments to Plate E9-3341 to show Borrow Area B and reinstate Borrow Area B on p 4, Sec. 2.41 and make adjustments to the reclamation plan and bond, accordingly. (Area I is not designated or discussed as a borrow area in the MRP.) (PB)

#### **NEICO Comments:**

Although Borrow Area B would provide a logical and perhaps more cost effective
place to retrieve soils for revegetation, this area is also the most logical site to be
used if the west side of the property were to used more as industrial site rather
than returning it to grazing and wildlife habitat. The industrial option has made
the Wellington site more appealing to those parties that have been interested in
developing and operated new activities at the site. NEICO has been marketing
the area with that in mind. In recent discussions with NEICO representatives,
they determined it prudent to maintain the industrial-use option for the future.
Representatives from the Division would be welcomed to discuss this matter
further with representatives from NEICO.

Accordingly, NEICO conducted several soil surveys to ensure there is adequate amounts of onsite borrow material for reclamation purposes – <u>without using</u> <u>Borrow Area B</u>, thus leaving open the possibility for this area to be marketed and used for an industrial site.

The soil surveys reported in the MRP provide data to show the other borrow areas would be acceptable for topsoil and substitute topsoil for revegetation. Moreover, the subsequent bond calculations reflect this standpoint. That said, if the industrial option is not exercised, and complete site reclamation were to proceed, Borrow Area B remains a viable option. Consequently, the soils dataset along with its delineation on a map have been retained in the MRP as an optional area for use at the time of final reclamation.

#### MRP Insertion Instructions:

• No changes to the borrow areas have been made in the MRP at this time.

19. [R645-301-541.400]: Site operations have changed since 1998, when Section 2.41 (reclamation plan) was written. Please re-evaluate whether the best-case scenario described in Section 2.41 (removal of coarse refuse by re-mining) is still feasible and whether the potential for using Borrow Area B soils (Dwg E9- 3511) is now possible, and make adjustments accordingly to the Reclamation plan described in Chapters 2 and 5 of the MRP. (PB)

#### **NEICO Comments:**

- Changes have been made to update Chapter 2 of the MRP.
- A redline/strikeout version has been included for Division review.
- Specifically, the information can be found in Section 2.41, pp.1-7, 11/20/12.

**20.** [R645-301-121.200 & -121.300]: The Table of Contents lists Tables 2-1 through 2-8, please provide page numbers for these tables in the Table of Contents. (PB)

#### **NEICO Comments:**

- Changes have been made to add the pages to the Table of Contents in the MRP.
- A redline/strikeout version has been included for Division review.
- Specifically, the information can be found in Table of Contents, p.vi, of this submittal.

21. [R645-301-121.200 &-243]: In addition to straw or hay mulch, the application of another form of organic matter was a variable in the 1991 test plot (Appendix A and Sec. 2.33, p. 2). The results of the 1994 test plot evaluation are reported in Section 3.41, but it is not clear what organic amendment was included as a variable. Please clarify. (PB)

- Changes have been made to add the pages to the current MRP.
- A redline/strikeout version has been included for Division review.
- Specifically, the information can be found in Section 3.41, p.19, 11/20/12.

**22.** [R645-301-121.200 & -244.200]: Section 3.41 p. 4a varies from the remainder of Section 3.41 and Section 2.41 with regard to the approach to seeding, surface roughening and mulch incorporation. Is ripping followed by green hay incorporation with drill seeding specific to a location within the permit area? If so, please specify on page 4a the area to receive the treatments described on page 4a. (PB)

- This site is another surface facilities site that was created by COVOL in 1997, long after the original surface facilities site constructed by U.S. Steel Corporation in 1957.
- Changes to clarify this have been made to add the pages to the current MRP.
- A redline/strikeout version has been included for Division review.
- Specifically, the information can be found in Section 3.41, p. 4a, 11/20/12.

**23**. No deficiencies were issued by Ingrid Campbell; however, the Division would like to remind the Permittee that they have committed to remove Class C noxious weed, tamarisk, in riparian areas and replanting with willow and cottonwood cuttings to enhance wildlife habitat (Mining and Reclamation Plan Volume I-A, Section 3.42).

#### **NEICO Comments:**

 Section 3.42 (page 2) does address tamarisk, but it does not refer to the entire reach of the Price River where this species is the dominant woody plant. The MRP states the following:

The only critical wildlife habitat in the permit area is the riparian area along the Price River. There has been very little disturbance created by the operations at Wellington along the Price River, but there is one small area that has been disturbed and will receive a concentrated effort for wildlife enhancement at the time of final reclamation (emphasis added). This area is located near the pump house along the Price River and adjacent to the Farnum county road.

The area is less than one acre (emphasis added), but with a concentrated effort at the time of final reclamation, valuable wildlife habitat could be created. The first step in this effort would be to remove all tamarisk plants in the area, especially along the Price River.

 Also as described in Section 5.40 (page 8) with reference specifically to reclamation in the pumphouse area, the MRP states the following:

The riparian vegetation near the Price River where the reclamation activities will occur is dominated two by non-native plant species: tamarisk (Tamarisk chinensis) and common reed (Phragmitis communis). Little or no work is expected to be necessary in the riparian vegetation immediately adjacent to the Price River, but some tamarisk plants in the area may need to be removed.

- Tamarisk is classified as a Class C noxious weed in the state of Utah which means
  the goal is "containment" of this species. It is declared as a noxious weed, not native
  to the state of Utah that is widely spread but poses a threat to the agricultural
  industry and agricultural products with a focus on stopping expansion.
- Even though it recognized as a worthwhile goal, due to the magnitude and complexity of such a project it is not the intention of NEICO's to attempt and eradicate this plant from their property entirely.

**24.** [R645-301-112.330]: The information in the current MRP presented below does not match the information found in the OSM/AVS database. The Operator should submit either updated pages for the MRP to reflect the correct information, or the Operator should provide a Secretary's Certificate or End Dates so that the AVS can update its records. (AN)

#### **NEICO**

- 1. The following individuals have a different Begin Date in the MRP as compared to the date listed in the AVS database.
  - a. Michael W. Yackira, President & Treasurer (AVS 6/01/04 vs. MRP Aug 2004)
  - b. Paul J. Kaleta, Secretary (AVS 2/01/06 vs. MRP Apr 2006)
  - c. Walter M. Higgins, Director (AVS 6/01/04 vs. MRP Aug 2004)

This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct the AVS.

### Nevada Power Company

- 1. The AVS shows Walter M. Higgins, Chairman and CEO, with a Begin Date of 10/01/04. The MRP shows a Begin Date of Aug 2000. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 2. The AVS shows Krestine M. Corbin, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of July 1999. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the ,4 VS.
- 3. The AVS shows T.J. Day, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of July 1999. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 4. The AVS shows James R. Donnelley, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of July 1999. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- S. The AVS shows Walter M. Higgins, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of August 2000. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 6. The AVS shows Philip G. Satre, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of January 2005. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 7. The following individuals are in the AVS database as an Officer or Director, but they are not listed in the MRP:
  - a. David Barney, Vice President, 10/01/93

- b. Charles Lenzie, COB and CEO, 10/01/93
- c. Richard Hinkley, Director, 5/01/91
- d. Richard Hinkley, Vice President, 10/01/93
- e. Cynthia Gilliam, Vice President, 10/01/93
- f. Steven Rigazio, Vice President, 10101/93.
- g, Gloria Weddle, Vice President, 10/01/93
- h. Fred Gibson, Jr., Director, 2/01/78
- i. John Goolsby, Director, 1/01/91 C. Ryan, Director, 9/01/78
- k. Frank Scott, Director, 5/l/72
- 1. Arthur Smith, Director, 1/01/59
- m. J. Tiberti, Director, 11/01/63
- n. Walter Higgins, President, 10/01/04
- o. Earnest East, General Counselor/Secretary/SV'P, 10/01/04

These discrepancies should be addressed by either correcting the MRP or submitting End Dates or a Secretary's Certificate to update the AVS database.

#### Sierra Pacific Resources

- I The AVS shows Walter M. Higgins, President, with a Begin Date of 10/01/04. The MRP shows a Begin Date of Aug 2000. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 2. The AVS shows Walter M. Higgins, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of August 2000. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 3 The AVS shows Philip G. Satre, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of January 2005. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 4. The following individuals are in the AVS database as an Officer or Director, but they are not listed in the MRP:
  - a. David Barneby, Vice President, 7/29/99
  - b. William Peterson, Sr. Vice President, 7/29/99
  - c. Steven Rigazio, President, 5131100
  - d. Gloria Weddle, Vice President, 7/29/99
  - e. Fred Gibson, Jr., Member, 7/29/99
  - f. Mark Ruelle, CFO/SVP/Treasure, 7/29/99
  - g. Matt Davis, Vice President, 7/29/99
  - h. Steven Oldham, Vice President, 6/20/00
  - i. Douglas Ponn, Vice President, 7/29/99
  - i. Mary Jane Reed, Vice President, 7/29/99
  - k. Mary Simmons, Controller, 7/29/99
  - l. Edward Bliss, Member, 7/29/99
  - m. James Murphy, Member, 7/29/99
  - n. Earnest East, General Counselor/Secretery/SVP, 10/01/04

These discrepancies should be addressed by either correcting the MRP or submitting End Dates or a Secretary's Certificate to update the AVS database.

#### **NEICO Comments:**

- This deficiency was addressed in the information described in **No. 1** above.
- Specifically, the information can be found in Section 1.20, pp. 1-5, 11/20/12.

#### New language in this January 31, 2013 submittal has been printed with blue font.

The following is the deficiency that was initially written by the Division in the Midterm Review (May 30, 2012); it was later addressed in the response from NEICO (November 20, 2012).

25. [R645-301-830.140]: The reclamation cost estimate which is approved and incorporated into the current Wellington Prep Plant mining and reclamation plan has not been updated to current unit costs. Current unit costs are used to calculate the direct costs of reclamation including demolition, backfilling and grading, and revegetation. Also, there has been on-site demolition that is not reflected in the MRP. Updates should be provided using the 2012 data from R.S. Means Heavy Construction Cost data manual and the Caterpillar Handbook or other appropriate resources. Also, bond summary sheets are not updated to current escalation factor estimates. The Permittee must provide updated information in terms of detailed estimated cost, with supporting calculations for the estimates, submitted by the permit applicant. This includes updated unit costs (to be used to update bond calculation spreadsheets) and updated escalation factors (used the Division's approved 1.2% and 5 year escalation). (JO)

Following the response from NEICO mentioned above (November 20, 2012) and a review by the Division, the follow-up deficiencies were then issued (December 20, 2012).

[R645-301-830.140]: The estimated unit costs for concrete demolition, loading, hauling, and pipe removal are not current and need to be updated. These cost need to be determined with the assistance of DOGM. (JO)

[R645-301-830.430]: The amount of time designated for the reclamation of Road Pond and Heat Dryer Pond needs to be verified. (JO)

[R645-301-830.430]: There are concrete building foundations within the disturbed area boundary that are not included in the demolition portion of the bonding calculation. These must be measured and included. (JO)

- An onsite visit was conducted at the Wellington Prep Plant site by a NEICO representative (Patrick Collins) and a Division representative (James Owen) on January 17, 2012 to address the above issues.
- Subsequently, Mr. Owen provided suggestions and recommendations for these costs.
- The bond calculations have been revisited and adjusted.
- Specifically, the information can be found in this submittal in Appendix J dated January 31, 2013.
- We have red-lined the changes in the attached bond spreadsheet (Appendix J).

Below is another follow-up deficiency that was written by the Division during the Midterm Review process (December 20, 2012).

**26.** [R645.731.222.1]: The Permittee has proposed to temporarily suspend collecting flow measurements from SW-2. The rationale was that this location no longer diverts or discharges water because the facility is no longer located there. In addition, degrading conditions of the stream bank over time have made the stream unsafe for access to collect a flow measurement.

The Permittee is required to collect flow measurements from all surface water sample locations in accordance with 731.222.1 and would therefore be out of compliance if flow cannot be collected at this sampling point. Please make the necessary upgrades to safely collect a flow measurement at SW-2 (or SW-2A). Alternatively, the Permittee may propose a different location to collect the required data. (AA)

- NEICO is withdrawing the request to temporarily suspend collecting flow measurements from SW-2.
- Language was added to the text to describe added safety precautions that will be implemented in the surface-water flow measurement protocol at SW-2 when necessary.
- When field conditions are deemed too unsafe to allow safe entry into the river, the "float" method will be used to collect flow data (as currently specified in the approved MRP).

## DEFICIENCIES



## MRP INSERTION INSTRUCTIONS

Task No. 4043

Task Name: 2012 Midterm Permit Review

The members of the Division's review team include the following individuals:

April Abate (AA) Priscilla Burton (PB) Ingrid Campbell (IC) Angela Nance (AN) James Owen (JO)

The Redline/Strikeout version from the November 20, 2012 submittal has been retained in this document. Changes to this version made in the January 31, 2013 submittal has been printed in blue font.

#### 1. DOGM Deficiency:

[R645-301-113.300]: Violation Notices. The MRP lists the most recent update of the violations database in 2004. This information should be updated. (AA)

#### MRP Insertion Instructions:

- Sec. 1.00 p. 1-7, 11/20/12, of this submittal replaces
- Sec. 1.00 p. 1-7, (various dates), of the Division's copy of the MRP
- Sec. 1.20 p. 1-16, 11/20/12, of this submittal <u>replaces</u>
- Sec. 1.20 p. 1-17, (various dates), of the Division's copy of the MRP

## CHAPTER 1

R645-301-100

LEGAL, FINANCIAL, OWNERSHIP & COMPLIANCE

### INTRODUCTION AND EXECUTIVE SUMMARY

#### 1.00 Introduction and Brief History

The Wellington Preparation Plant is located in Carbon County, Utah in portions of Sections 8, 9, 10, 15, 16 and 17, Township 15S, Range 11 E, SLBM. The Plant was originally established in 1958 by United States Steel Corporation as a coal cleaning, preparation and loading facility. The Plant was in continuous operation until 1985 and was subsequently sold to Kaiser Coal Corporation in 1986. After the latter declared bankruptcy, the Plant was purchased through the court by Genwal Coal Company, a wholly owned subsidiary of Nevada Electric Investment Company (NEICO), in August 1989. The operator for Genwal was Castle Valley Resources (CVR).

Pursuant to a Joint Ownership & Operation Agreement dated as of July 1, 1991, and executed as of July 11, 1991, Intermountain Power Agency (IPA) and NEICO jointly owned certain coal and loadout properties including portions of the Wellington Preparation Plant's permit area. By a Coal Sales and Loading Services Agreement dated July 1, 1991 and executed July 11, 1991, CVR agreed with IPA and NEICO to operate and maintain loadout properties including the Wellington Preparation Plant.

Genwal later became the operator of the Joint Ownership land coowned by NEICO and IPA. In other words, NEICO and IPA owned a portion of the area called "Joint Ownership Area" (approximately 120.2 acres). The operator at that time was Genwal. NEICO, however, was sole owner and operator of the remainder of the property (approximately 1579.6 acres).

Pursuant to a Special Warranty Deed (dated January 11, 1995) IPA deeded to NEICO their interest in the Joint Ownership Area. A "Termination Agreement" between IPA and NEICO was signed simultaneously to sale NEICO's interest in the Crandall Canyon Project to Andalex Resources, Inc. (Genwal). Therefore NEICO has been sole owner and operator of the entire Wellington Preparation Plant property (ACT/007/012) since January 1995.

Nevada Power Company merged with Sierra Pacific Resources (Reno) in July 1999. By 2012, Nevada Power Company became an operating affiliate of NV Energy, Inc, (NEICO is an affiliate of Nevada Power Company). For more detailed ownership information, refer the following LEGAL/FINANCIAL/OWNERSHIP following section (Section 1.20).

Elevation at the Wellington Plant is approximately 5,300 - 5,500 feet above sea level, with mean annual precipitation of six to eight inches. The site lies primarily on gently rolling slopes of Mancos Shale and valleys of alluvial deposits and is characterized by salt desert shrub vegetation communities. The Denver and Rio Grande Western Railroad passes through the site and the Price River also dissects the property. Historic land use of the area has been dominated by grazing of domestic livestock, wildlife habitat and limited crop production. About 400 acres within the property boundaries have been disturbed by coal cleaning and preparation operations since 1958.

#### History of Operations at Wellington

From 1958 until 1985, the operation history of the property was that of receiving coal by rail, preparation of coal (coal cleaning), and shipping a blended product by rail. When Genwal Coal Company purchased the area that operation was terminated. The railroad load-out facility at Wellington then consisted of a much simplified flow of product. Coal was crushed at the mine site, transported by truck to the Wellington facility, temporarily stored on the ground, screened, and then loaded into waiting railcars.

The actual loading operation was part of a new system installed by Genwal Coal Company in September and October of 1989 and made operational during November of 1989. The new loading system used only one conveyor belt system of the old Kaiser/U.S. Steel preparation plant.

The Wellington Loadout Facility was later used only to store and load coal. Following that, all transportation of coal from the mine and screening was discontinued.

In 1997 the Permittee, NEICO, designated Earthco as the Operator of the Wellington Preparation Plant. Earthco began reclamation of the site and by initiating a post-mining land use change to industrial. During this operation, all buildings and most structures west of the Price River were demolished and salvaged. The area was also graded in preparation for development of an industrial site. Later, additional clean-up and grading work was done in the same area under the direction of NEICO. A major company in the area had secured an option to purchasing this portion of the permit area if the post-mining land use was changed to industrial. Due to an unanticipated change in the operational plans of the potential buyer, the option to buy was not exercised.

1.00 4 11/20/12

On the east side of the Price River, a modular coal fines wash plant, truck loadout, slurry tank, NW tailings impoundment and retention berm, power lines and above ground water and tailings pipelines was constructed to recycle the coal refuse from the slurry ponds area. The area to implement this process was leased by company called Covol Technologies. This use is entirely consistent with all previous activities that have occurred and been permitted in the past. Site grading, diversions and sediment control measures have been directed to control any runoff that may occur into the Lower Refuse Pond or into Alternative Sediment Control Areas (ASCA's) 4 & 5. majority of the facilities is located on the previously disturbed Coarse Slurry Pile. A substation is located near the wash plant. The river pumphouse will not be refurbished to pump water. However, a pump was be installed in a supply well near the river pumphouse.

The type of equipment installed to process the coal fines includes conveyors, screens, hoppers, flotation columns, centrifuges, pumps, tanks, and cyclones. Construction was done in a phased manner to allow for some production of washed fines to begin while the final additions to the plant were made. The final reclamation design at the plant site on the Coarse Slurry Pile was consistent with the current reclamation plan.

Regrading activities were included in the modification to the bond calculations even though very minimal earthmoving will be required. Dismantling and disposal of the surface facilities were the focus of the revised bond calculations.

Covol's modular coal fines wash plant was idle for much of 1999. Another company, TechMat, LLC, has signed a lease to resume these activities.

Following cessation of the TechMat operations, the wash plant was dismantled, salvaged and the site was reclaimed in 2004.

The current owner, NEICO, is evaluating the remainder of the permit area for the future. As mentioned above, the Wellington site had been proposed as an industrial area or could be used in its current condition. The area is zoned "heavy industrial" and future plans may be conducted to develop it as such. General and very specific plans have been outlined previously to the State of Utah, Division of Oil, Gas & Mining (DOGM). Plans are currently being made for development of this property. If these plans continue, amendments to the present permit will be prepared and submitted to DOGM related to the above proposed changes.

#### Property Description and Acreage

The property description and applicable acreage of the current permit area is presented below.

#### PROPERTY DESCRIPTION

The permit area is located at 6000 Wash Plant Road, City of Wellington, Carbon County, Utah. A total of 1573.5 acres are current in the permit area. A property description of the permit area is given below.

Township 15 South, Range 11 East, Salt Lake Base and Meridian:

Section 8	E1/2 SE1/4 (portions s. of Ridge Road), W1/2 SE1/4
	(portions s. of Ridge Road; excl. portion n. of railroad
	tracks)

Section 9 S1/2, portions of S1/2 N1/2,

Section 10 W1/2 SW1/4

Section 15 W1/2 NW1/4

Section 16 All

Section 17 E1/2 SE1/4, NE1/4

Wellington Preparation Plant Acreage	
Undisturbed	1307.8
Total Disturbed/Bond (see Dwg. E9-3333)	392.0
Total Permit Acreage (see Dwgs. E9-3341 and E9-3333)	1699.8
Area Removed from Permit Area (north of Ridge Road)	126.3
Total of the Present Permit Area	1573.5

#### 1.20 LEGAL/FINANCIAL/OWNERSHIP

#### IDENTIFICATION OF INTERESTS - (R645-301-112)

#### 112.100 Identification of Permittee, Operator, and Owner

- 1. Permittee: The permittee, Nevada Electric Investment Company (NEICO), is a corporation duly organized, validly existing and in good standing under the laws of the State of Nevada.
- 2. Operator: The operator, Nevada Electric Investment Company (NEICO), is a corporation duly organized, validly existing and in good standing under the laws of the State of Nevada.
- 3. Owner: The owner, Nevada Power Company, is the sole owner of NEICO and is a corporation duly organized, validly existing and in good standing under the laws of the State of Nevada.
- 4. Affiliates: Nevada Power Company is an operating affiliate of NV Energy, Inc,; NEICO is an affiliate of Nevada Power Company.

#### Names, Addresses & Telephone Numbers:

- 1. Permittee

  NEVADA ELECTRIC INVESTMENT COMPANY

  6226 West Sahara

  P.O. Box 230

  Las Vegas, Nevada 89102

  ph. (702) 367-5692

  Employer Identification Number: 88-6002040
- 2. Operator

  NEVADA ELECTRIC INVESTMENT COMPANY
  6226 West Sahara
  P.O. Box 230

  Las Vegas, Nevada 89102

  ph. (702) 367-5692

  Employer Identification Number: 88-6002040

3. Owner

NEVADA POWER COMPANY
6226 West Sahara Ave.
P.O. Box 230
Las Vegas, Nevada 89151
ph. (702) 367-5692
Employer Identification Number: 88-6002040

## 112.210 Name, Address & Telephone Number of Resident Agent:

Patrick D. Collins, Ph.D. MT. NEBO SCIENTIFIC, INC. 330 East 400 South, Suite 6 P.O. Box 337 Springville, Utah 84663 (801) 489-6937

#### 112.230 Abandoned Mine Land Reclamation Fee

The operator listed below will be responsible for the Abandoned Mine Reclamation Fee if "mining" occurs on the property and if this fee is still assessed for the type of mining that is proposed for future activities.

NEVADA ELECTRIC INVESTMENT COMPANY
6226 West Sahara
P.O. Box 230
Las Vegas, Nevada 89102
ph. (702) 367-5692
Employer Identification Number: 88-6002040

## 112.300 Names and Addresses of Officers, Directors

## 1. Permittee & Operator:

NEICO Officers & Directors (Present)			
Name	Employee ID Number	Title	Begin Date
Robert E. Stewart	RS22966	President	Dec 2010
Tony F. Sanchez	TS22372	Vice Pres.	Dec 2008
Paul J. Keleta	PK21675	Secretary	Apr 2006
Jonathan S. Halkyard	JH26665	Treasurer	Jul 2012

## 2. Owners:

Nevada Power Company Officers & Directors (Present)			
Name	Employee ID Number	Title	Begin Date
Michael W. Yackira	MY20883	President and Chief Executive Officer	Oct. 2004
Jonathan S. Halkyard	JH26665	Executive Vice President & Chief Officer	July 2012
Paul J. Kaleta	PK21675	Executive VP, Shared Services, General Counsel and Corporate Security	Apr 2006
Dilek L. Samil	DS24821	Executive Vice President & Chief Operating Officer	Jun 2010
Alice A. Cobb	AC26138	Senior Vice President, Human Resources & Information Technology	Jan 2012
Roberto R. Denis	RD20988	Senior Vice President, Energy Delivery	Oct. 2004
Tony F. Sanchez III	TS22372	Senior Vice President, Government and Community Strategy	Oct 2007
Robert E. Stewart	RS22966	Senior Vice President, Customer Relationship	Aug 2009
E. Kevin Bethel	KB22760	Vice President, Chief Accounting Officer and Controller	Apr 2008
Bruce A. Bullock	BB3945	Vice President, Customer Relationship	May 2011
Kevin C. Geraghty	KG23301	Vice President, Energy Supply	Jul 2012
Frank P. Gonzales	FG3167	Vice President, Corporate Services	May 2011
Kevin J. Judice	KJ26480	Vice President and Chief Information Officer	May 2012
Gary L. Lavey	GL23648	Vice President, Internal Audit and Chief Risk Officer	May 2010
Mary O. Simmons	MS4463	Vice President, External Affairs	Jun 2008
Mario Villar	MV21359	Vice President, Transmission	Feb 2010

NV Energy, Inc Officers & Directors (Present)			
Name	Employee ID Number	Title	Begin Date
Officers	1D INUMBER		
Michael W. Yackira	MY20883	President and Chief Executive Officer	Oct 2004
Jonathan S. Halkyard	JH26665	Executive Vice President & Chief Officer	Jul 2012
Paul J. Kaleta	PK21675	Executive VP, Shared Services, General Counsel and Corporate Security	Apr 2006
Dilek L. Samil	DS24821	Executive Vice President & Chief Operating Officer	Jun 2010
Alice A. Cobb	AC26138	Senior Vice President, Human Resources & Information Technology	Jan 2012
Roberto R. Denis	RD20988	Senior Vice President, Energy Delivery	Oct 2004
Tony F. Sanchez III	TS22372	Senior Vice President, Government and Community Strategy	Oct 2007
Robert E. Stewart	RS22966	Senior Vice President, Customer Relationship	Aug 2009
E. Kevin Bethel	KB22760	Vice President, Chief Accounting Officer and Controller	
Board of Directors			
Phillip G. Satre	N/A	Chairman of the Board	Jan. 2005
Joseph B. Anderson, Jr	N/A	Director	Feb. 2005
Glenn C. Christenson	N/A	Director	May 2007
Susan F. Clark	N/A	Director	Nov 2008
Stephen E. Frank	N/A	Director	Feb 2009
Brian J. Kennedy	N/A	Director	Feb 2007
Maureen T. Mullarkey	N/A	Director	June 2008
John F. O'Reilly	N/A	Director	July 1999
Donald D. Snyder	N/A	Director	Nov. 2005
Michael W. Yackira	MY20883	Director	Feb 2007

## NAME(S) UNDER WHICH PERMITTEE AND OPERATOR PREVIOUSLY OPERATED MINING ACTIVITIES - (R645-301-320)

1. Permittee and Operator:

NEICO owned 50% of the Crandall Canyon Mine
(ACT/015/032) several years ago.

#### 112.400 Pending, Current and Previous Coal Permits:

1. Permittee's Previous Coal Permits

Genwal Coal Company, which was in the past owned by NEICO, held a coal mining permit for the Crandall Canyon Mine. It is now dormant and does not conduct business operations. Pertinent information about the mine is a follows:

Name and Address: Crandall Canyon Mine Genwal Coal Company P.O. Box 1420 Huntington, Utah 84528 ph. (435) 687-9813

2. Owner's Previous Coal Permits

Nevada Power Company and NV Energy has had no other coal permits in the past 5 years.

#### 112.500 Legal or Equitable Owners of Record

The legal or equitable owner of the areas to be affected by the surface operator and facilities of the permit applicant are:

#### Legal Title:

NEVADA ELECTRIC INVESTMENT COMPANY 6226 West Sahara Avenue Las Vegas, Nevada 89102

## 112.510 The Holders of Record of Any Leasehold Interest in Areas to be Affected by Surface Operation of Facilities

MCI

136 East South Temple University Club Bldg., Suite 2000 Salt Lake City, UT 84111

D&RGW - Southern Pacific Railroad 250 South Broadway Green River, UT

### 112.520 Owner of Coal Estate for the Mined Areas

Not applicable. All preparation plant operations occur on the surface.

## 112.600 Owners of Record of Surface Areas Within and Contiguous to the Permit Area:

## Property Owners Inside Permit Boundary

Name & Address	Parcel Number	Acres
Nevada Electric Investment Co. 6226 W Sahara Ave. P.O. Box 230 Las Vegas, NV 89151-0001	02-2174	80.00
Nevada Electric Investment Co. P.O. Box 10100 Reno, NV 89520-0000	02-1931-C	413.95
Nevada Electric Investment Co. 6226 W Sahara Ave. P.O. Box 230 Las Vegas, NV 89151-0001	02-1664-3	80.00
Nevada Electric Investment Co. 6226 W Sahara Ave. P.O. Box 230 Las Vegas, NV 89151-0001	02-1664-4	523.86
Nevada Electric Investment Co. 6226 W Sahara Ave. P.O. Box 230 Las Vegas, NV 89151-0001	02-1664-5	203.80
Nevada Electric Investment Co. 2835 S Jones Blvd Suite 5 Crandall Canyon Project Las Vegas, NV 89151-0001	02-1664-6	120.04
Denver & Rio Grande Western Railroad Union Pacific Railroad Co. One market Plaza SP Bldg Property Tax Dept. Room 200 San Francisco, CA 94105-0000	2A-1690	6.07
Wellington City P.O. Box 559 Wellington, UT 84524-0000	2-1944	0.88

## **Property Owners Adjacent to Permit Boundary**

Lee Ann C. P.O. Box 146 Mayfield, UT 84643-0000	2-1951-4	5.0
Roger Brown 401 Catherine St. Steelton, PA 17113	2-1951	10.24
Dee L. Hugely 845 N Castle Heights Dr. Price, UT 84501	2-1947	29.47
Delbert K & Brenda Thayne 7488 E Highway 6 Price, UT 84501	2-2172	117.17
United States of America Bureau of Land Management No Address listed	2A-1656-10F Section 10, T15S, R11E, SLB&M	None listed
United States of America Bureau of Land Management No Address listed	2A-1656-15F Section 15, T15S, R11E, SLB&M	None listed
United States of America Bureau of Land Management No Address listed	2A-1656-22F Section 22, T15S, R11E, SLB&M	None listed
United States of America Bureau of Land Management No Address listed	2A-1656-21F Section 21, T15S, R11E, SLB&M	None listed
United States of America Bureau of Land Management No Address listed	2A-1656-10F Section 10, T15S, R11E, SLB&M	None listed
Utah State Institutional Trust Lands No Address listed	2A-1656-20S Section 20, T15S, R11E, SLB&M	None listed
Birch Creek Limited Partnership Arrowwood Management Corp. 3225 McLeod DR. Suite 100 Las Vegas, NV 89121	2A-9-A	640.00
United States of America Bureau of Land Management No Address listed	2A-1656-8F Section 8, T15S, R11E, SLB&M	None listed

Emery Industrial Resources Inc. 148 S. 100 E. Spanish Fork, UT 84660	2-1930-2B	5.00
Sharon Hansen ETAL P.O. Box 264 Riverton, UT 84065	2-1930-1B	11.00
Dale L. & Barbra H. Terry 1290 E 300 N Price, UT 84501	2-1930-5	94.83
Wellington Mountaineers P.O. Box 921 Wellington, UT 84542	2-1946-1	5.10
Carbon County Carbon County Clerk 120 East Main St. Price, UT 84501	None Listed County Road #480 Ridge Road	None Listed

# 112.610 The Holders of Record of Any Leasehold Interest in the Coal to be Mine

None

# 112.700 Mine Structures that require MSHA Numbers

Plant Refuse Pile - 1211-UT-09-00099-01 Clear Water Pond - 1211-UT-09-00099-02 Lower Refuse Pond - 1211-UT-09-00099-03 Upper Refuse Pond - 1211-UT-09-00099-04 Pond Refuse Pile - 1211-UT-09-00099-05

#### 112,800

There are no outstanding interests in lands, options or pending bids on interests held or made by the applicant for lands which are contiguous to the areas to be covered by the permit.

# VIOLATION INFORMATION (R645-301-113)

## 113.100 Compliance Information

Neither the permittee, operator, or any of their subsidiaries, affiliates or persons controlled by or under common control with the permittee have had a federal or state mining permit suspended or revoked in the last five years.

The permittee has not forfeited a performance bond or similar security deposited in lieu of bond in the past five.

# 113.200 <u>Explanations of Suspensions, Revocations and</u> Forfeitures

Not applicable

# 113.300 Violation Notices

No violation notices have been issued to the permittee in connection with any underground or surface coal mining activities for the past five-year period.

#### RIGHT OF ENTRY INFORMATION (R645-301-114)

# 114.100 Right of Entry and Operations Information

In 1989, when the property was purchased, the permittee obtained the legal right to enter and begin onsite activities. A brief summary for this documentation follows.

Pursuant to a Joint Ownership & Operation Agreement dated as of July 1, 1991, and executed as of July 11, 1991, Intermountain Power Agency (IPA) and NEICO jointly owned certain coal and loadout properties including portions of the Wellington Preparation Plant's permit area. By a Coal Sales and Loading Services Agreement dated July 1, 1991 and executed July 11, 1991, CVR agreed with IPA and NEICO to operate and maintain loadout properties including the Wellington Preparation Plant.

Genwal later became the operator of the Joint Ownership land coowned by NEICO and IPA. In other words, NEICO and IPA owned a portion of the area called "Joint Ownership Area" (approximately 120.2 acres). The operator at that time was Genwal. NEICO was sole owner and operator of the remainder of the property (approximately 1579.6 acres).

Pursuant to a Special Warranty Deed (dated January 11, 1995) IPA deeded to NEICO their interest in the Joint Ownership Area. A "Termination Agreement" between IPA and NEICO was signed simultaneously to sale NEICO's interest in the Crandall Canyon Project to Andalex Resources, Inc. (Genwal). Therefore NEICO has been sole owner and operator of the entire Wellington Preparation Plant property (ACT/007/012) since January 1995.

NEICO as the new permit holder continues to honor the agreements entered into by CVR and Genwal that allow access.

Much of the above-mentioned documentation has been retained in the MRP at the end of Chapter 1.

114.200 Not applicable.

## R645-301-115 STATUS OF UNSUITABILITY CLAIMS

# 115.100 Unsuitability Claims

The permit area in not within an area designated as unsuitable or under study as an area designated as unsuitable under R645-103-300, R645-103-400, or 30 CFR 769.

## 115.200

Not applicable

## 115.300 Distances From Dwellings and Public Road

The plans include operations that have been done previously within 100 ft of a county road. Current operations in the area are minimal. A letter from the county acknowledging the proximity to this road has been included in the Appendix following Chapter 1.

The operator does not propose to mine or perform any other operations within 300 feet of an occupied building.

## R645-301-116 PERMIT TERM INFORMATION

The permit renewal date occurs on a 5-year basis.

The Wellington site began operations as a coal loadout in 1989 upon permit transfer. The site operated as such for a number of years. Since that time, approval for studies of fines removal was attained and these operations were conducted by different operators who leased the property from the current permittee, NEICO. It is anticipated that removal of these fines may once again occur in the future. Other activities such as demolition, dismantling, salvage, revegetation and other reclamation activities have also occurred at the Wellington site.

NEICO has been actively considering other options for future operations at the site; feasibility studies are currently being conducted. When appropriate, more specific information about such plans can be obtained directly from the NEICO.

# PERSONAL INJURY AND PROPERTY DAMAGE INSURANCE (R645-301-117)

## 117.100 Certificate of Insurance

A copy of or NEICO's Certificate of Insurance with PRICE INSURANCE AGENCY in the amount required under the Utah Coal Program is available in Wellington's Inspection Book and is provided to the Division's inspectors when requested.

## 117.200 Newspaper Advertisement and Proof of Publication

Notices of publication have been submitted to the local newspaper following Division endorsements when appropriate in the permit process.

# 117.210 Statement by Operator

A statement by the owner, NEICO agreeing to comply with appropriate requirements is enclosed in the Appendix following Chapter 1.

**2.** R645-301-114.100]: Right of Entry. The ROE information provided in the section deals solely with the COVOL lease and their ROE agreement with NEICO. The remainder of the section includes the lease agreement between NEICO and COVOL. There was no information in this section discussing the legal right of entry for the Permittee themselves. This section should reference a deed and/or any other lease agreements that are in place for the Permittee to demonstrate legal ROE in order to comply with this regulation. (AA & PB)

## **MRP Insertion Instructions:**

 This deficiency was addressed in the information described in No. 1 above, so no additional insertions are needed.

3. [R645-301-116.100]: Permit Term Information. The information regarding the permit term was last updated in 1994. If any information about the long-term operational plan for the site has changed, than that information should be updated in this section also. (AA)

#### MRP Insertion Instructions:

 This deficiency was addressed in the information described in No. 1 above, so no additional insertions are needed. **4.** [R645-301-722.100]: Location and Extent of Ground Water. This section discusses the nature and extent of groundwater within the permit area. The section references Table 722-1 with water level readings collected in 1990. This table however, provides data current up through 1998. The table should be updated to include more recent groundwater gauging levels while preserving the historic data for comparison. The reference in the narrative text should also then be updated. (AA)

## **MRP Insertion Instructions:**

- Sec. 7.22, p. 1, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.22, p. 1, 7/15/90 of the Division's copy of the MRP
- Sec. 7.22, Table 7.22-1, 11/20/12 of this submittal replaces
- Sec. 7.22, Table 7.22-1, of the Division's copy of the MRP

## 7.22 CROSS SECTIONS AND MAPS (R614-301-722)

Hydrological structure cross-sections are referenced throughout Appendix II, and cross-sections and maps are in Appendix III-A.

## 7.21.1 GROUND WATER LOCATION AND EXTENT

As indicated in Section 6.0, the geology of the load out facility area consists of the Blue Gate Shale member of the Mancos Shale formation overlain by slopewash and floodplain alluvial deposits. Ground water is found in each of these deposits. Ground water has been identified, within the load-out facility area, in 13 of the 14 monitoring wells on the site. Table 722.1 presents the water level readings collected in May 1990, 1999, and June 2012. Dwg. G9-3509 shows the location of the monitoring wells and the potentiometric surface map for the facility area. The drawing indicates that the ground water flow is from the hills to the north and south of the site toward the Price River. Water levels measured during June 2012 were generally similar to previous values.

Underlying the load-out facility, the ground water gradient is very gentle at 0.005 foot per foot. Under the abandoned tailings pond, the gradient is also quite gentle, ranging from 0.006 to 0.01 foot per foot. However, at the contact between the tailings and the river alluvium, the gradient steepens to 0.05 foot per foot. Monitoring well GW-5, the dry well, is located in this region where the water table drops toward the river. Originally completed in the ground water seepage mound from the operational tailings ponds, the bottom of the well is presently located an estimated 7 feet above the ground water surface.

Table 7.22-1

Wellington Preparation Plant Well and Water Level Data

Well	Static Water	Static Water	Total Depth	Stick-up	Screened
ID	Level 1990,	Level June	(ft-bgl**)	(ft)	Interval
	1998	2012			(ft-btc)
	(ft-btc*)	(ft-btc*)			
GW-1	14.31	14.30	22.20	2.30	-
GW-2	24.62	25.43	31.50	1.45	12.0-31.5
GW-3	18.30	Dry	22.00	2.30	9.0-22.0
GW-4	9.07	8.30	31.90	2.28	-
GW-5*	-	-	22.50	<del>-</del>	-
GW-6	8.68	6.81	34.00	2.30	17.0-34.0
GW-7	10.48	11.08	37.85	2.80	-
GW-8	26.83	27.69	58.35	1.92	43.0-58.0
GW-9	15.14	14.88	36.10	6.05	-
GW-10	13.55	12.67	46.46	1.66	-
GW-12	9.17	8.03	42.20	2.32	-
GW-13	24.20	25.52	26.30	1.80	-
GW-14	13.68	10.48	45.12	2.15	26.0-45.0
GW-15A	6.42	11.34	14.20	3.0	9.2-14.2
GW-15B	5.74	10.62	26.10	3.0	21.1-26.1
GW-16	41.59	45.52	69.25	3.0	59.25-69.25
GW-17	20.90	23.47	24.30	3.0	14.30-24.30

# New Surface Water Sampling Location

SW-2a monitors water quality only (use SW-2 for flow rate)

7.22 11/20/12

<sup>\*</sup>ft – below top of casing
\*\* ft – below ground level

**5.** [R645-301-722.400]: Location and Depth of Water Wells. This regulation is missing from the plan. Please add a reference to the map showing the locations of all groundwater monitoring wells and any other water wells within and adjacent to the permit area. A reference to the well location map and Table 7.22-1 should be referenced here. (AA)

Insert 7.22 page 4 (replaces old 7.22 page 4)

## **MRP Insertion Instructions:**

- Sec. 7.22, p. 4, 11/20/12 of this submittal replaces
- Sec. 7.22, p. 4, 09/10/97 of the Division's copy of the MRP

has not been in operation since 1984, these structures have been dry excluding small amounts of water due to run-off of surrounding watershed areas. They will again impound water once the Covol Wash Plant becomes operational.

The Clearwater Basin was constructed with a lining of clay and clay loam to form an impervious liner. The upper two basins were not similarly lined. This refuse area is separated from the load out area by the Price River. The flow in the river greatly varies with the seasons and precipitation and snow melt. The Price River flows at the Woodside Station # 09314500 south of the property are referenced in Table 7.22-9 through 7.22-13. Flow pattern of the surface drainages are shown on Drawing F9-1777.

# 7.22.3 <u>Elevations and Locations of Monitoring Stations</u>

The location of the water monitoring sites is shown on Drawing E9-3451. Elevations of the ground water monitoring wells, along with the Ground Water surface is located on Drawing G9-3509.

# 7.22.4 Location and Depth of Water Wells

The locations of water wells are shown on Drawing E9-3451. Completion information for water wells, including total well depths, screened intervals, and depths to water are provided in Table 7.22-1.

## 7.22.5 Contour Maps of Permit Area

Dwg F9-177 shows the contours of the property including disturbed and undisturbed areas. The detailed topography associated with the Covol Wash Plant site and the Refuse Basin is shown on Drawings 712a and T1-9596.

6. [R645-301-723]: Sampling and Analysis. This section describes the water sampling plan for the site. This will likely be updated when the Probable Hydrologic Consequences (PHC) section of the plan gets updated. In addition, there is language in this section discussing COVOL's water monitoring responsibilities. This information should be updated. Furthermore, this section discusses the need to monitor groundwater for the presence of BTEXN and propylene glycol compounds. This action was based on the operational activities at the COVOL wash plant when additives were used in the coal washing process. Since these compounds were not detected in significant concentrations, continued monitoring no longer appears necessary. The language in this section should be updated to reflect the historic operations at the COVOL wash plan. (AA)

## **MRP Insertion Instructions:**

- Sec. 7.23, p. 1, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.23, p. 1, 7/22/98 of the Division's copy of the MRP

# 7.23 Sampling and Analysis (R645-301-723)

The owner/operator of the facility will carry out the hydrological sampling protocol listed in the permit under Sections 7.24.1 and 7.24.2 and in accordance with the appropriate regulations. Beginning with the fourth quarter of 1997, Covol will be responsible for collecting surface water and ground water samples for all sites east of, and including, the Price River. This includes surface water sites SW-1 through SW-7 and groundwater sites GW-1 through GW-5, GW-6, and the recently installed monitoring wells GW-15a and b, GW-16 and GW-17. Dry well GW-5 will be officially eliminated from the monitoring program as of the fourth quarter of 1997; it has been abandoned, sealed and reclaimed by Covol.

All of the ground and surface water sites are sampled on a quarterly basis using the parameters shown on Table 7.24-2 and 7.24-5. In addition, beginning with the third quarter of 1998, four of the sites (GW 4, GW 6, SW 4 and SW 5) will be monitored for the presence of BTEX N and propylene glycol. The BTEX N analysis consists of measurements of benzene, toluene, ethyl benzene, xylene, and naphthalene concentrations. Section 7.31 provides the rational for this addition to the monitoring plan.

The owner/operator will verify that the analysis of the samples is being done in accordance with the methodology in "Standard Methods for the Examination of Water and Wastewater" or 40 CFR parts 136 and 4344.

7. [R645-301-724]: Water Quality. This section references water quality data up through May 1997. This section summarizes the tabulated data found in Table 7.24.3. This information should all be updated based on the outcome of the PHC evaluation. The Permittee may want to consider consolidating some of these data tables or removing them altogether from the plan since this data is all available electronically through the Division's electronic water quality database. (AA)

## **MRP Insertion Instructions:**

Please remove/delete the following tables:

 The following tables in Sec. 7.24 of the Division copy of the MRP should be removed:

Table 7.24-3

Table 7.24-3a

Table 7.24-3b

Table 7.24-3c

- Sec. 7.24, pp. 1-3, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.24, p. 1, 12/05/97 and pp. 2-3 09/10/97 of the Division's copy of the MRP
- Sec. 7.24, Table 7.24-2, 11/20/12 of this submittal replaces
- Sec. 7.24, Table 7.24-2 of the Division's copy of the MRP
- Sec. 7.24, Table 7.24-5, 11/20/12 of this submittal replaces
- Sec. 7.24, Table 7.24-5 of the Division's copy of the MRP

#### 7.24 BASELINE INFORMATION

#### 7.24.1 GROUNDWATER INFORMATION

#### WATER RIGHTS

A search of all the ground water rights located within a three mile radius of the permit boundary was conducted. These ground water rights are summarized in Table 7.24-1 with Dwg. G9-3507 showing the location of each water right.

#### WATER QUALITY

Ground water quality data have been collected in the area of the load-out facility since 1985. This data collection activity has been conducted by several different owners and sampling firms. Since no information is available about the methods used to sample the ground water a anion/cation balance test was applied to all of the ground water samples. Milliequivalent values of the anions and cations in each sample were summed and the percent difference calculated. If the percent difference between the cation sum and the anion sum exceeded 10 percent, the data for that sample were assumed to be in error. The ground water sampling protocol, which has been used since December, 1989, consists of collecting the water samples in accordance with the procedures stated in the Guidelines for Establishment of Surface and Ground Water Monitoring Programs for Coal Mining and Reclamation Operations, the Division, 1986. A copy of the Water Quality Parameters can be referenced in Table 7.24-2. Cation

The groundwater quality data, collected from 1985 through mid-1991 have been entered into the Divisions electronic water quality database compiled and summarized in Table 7.24 3. To update information as part of the Covol Wash Plant amendment, data collected at sites east of the Price River (GW-1, GW-2, GW-3, GW-4, and GW-6) from mid-1991 through May 1997 has been submitted to the Division's electronic water quality database. are summarized in Table 7.24 3a. (No water quality data has been reported at GW-5 in recent years, as the well has evidently been dry.) Further, samples from these five wells were sampled by Covol in August, 1997 for all baseline parameters, and these data have been entered into the Division's electronic water quality database. are reported in Table 7.24 3b. Following the same format as Tables 7.24 3 and Table 7.24 3a, Table 7.24 3c has been created to provide monitoring information obtained by Covol since August 1997. These summaries contain a listing of all water quality data for each sample site. Sample results assumed to be in error because of the anion/cation imbalance have been separated in the table from the sample data assumed to be good. Basic statistical evaluations, consisting of maximum, minimum, mean, standard deviation, and number of analyses, of each parameter was conducted for the data assumed to be good. The erroneous sample data contain the work "Error" in the Comment column of the table and are listed below the data statistical summaries discussed.

Comparison of ground water quality data with the Utah ground water quality standards indicate pH values outside the acceptable range for two wells, GW-1 and GW-7. For the GW-1 sample of 12/87, the pH value was 6.33. The GW-7 sample of 8/86 had a pH value of 9.65. The updated data set also showed at least one pH value outside the acceptable range on three different dates and at four out of the five wells. The inconsistent nature of these exceedences suggests sampling and/or analytical error rather than natural occurrences. All other samples meet the ground water standards.

An evaluation of the major cations and anions was conducted to classify the ground water. The ground water in the load-out area classifies as a strong sodium-sulfate type water. This type of water classification is expected due to the high concentrations of soluble salts, including gypsum ( $CaSO_4 \cdot 2H_2O$ ), and mirabilite ( $Na_2SO_4 \cdot 10H_2O$ ), and thenardite ( $NaSO_4$ ), present in the Mancos Shale (Waddell, et. Al., 1981). To assist in understanding the seasonal variations of ground water quality, graphs for selected parameters were developed for each well using the pre-1991 data. These graphs are presented as Figures 7.24-1

through 7.24-6. The graphs present the concentrations of Iron, Manganese, pH, TDS, TSS, and Water Level for each of the ground and surface water sampling sites for the original data set through mid-1991. The discussions below relate to that data set. The pH graphs indicate little seasonal variation. Although graphs for ground water TDS do not show seasonal variation, some show an increase in TDS with time. Wells GW-3, GW-8, GW-9 and GW-11 show the greatest variation with time.

There also appears to be an abnormal variation in TDS values with reference to both time and location. GW-2 and GW-3 had similar TDS concentrations during 1985 and 1986. However, in 1987 GW-3 experienced a dramatic ten fold rise in TDS values while the TDS values for GW-2 have remained relatively low over time. Both GW-2 and GW-3 are located in the Upper Refuse Basin and within 1,500 feet of each other. The reason for this abrupt change in the TDS levels of GW-3 is not apparent.

TDS values determined for the samples taken from GW-6 were all within the 2,500 to 6,800 ppm range except for a TDS value for the 11/85 sample which was 32.6 ppm. This is another order-of-magnitude difference for which there is no apparent explanation. It is probable that the methods of sampling changed or that a recording error was made, however without detailed field or lab notes the exact cause is unlikely to be determined.

TDS values obtained from samples taken from GW-13 are also unusually high compared to the valued obtained from other samples. The location of GW-13 does not suggest that these values should be higher and may indicate that these data may be questionable.

The graphs for Total Iron and Total Manganese indicate considerabley-variability. One of the companies which has been sampling the wells suggests that the reason for the variability may be due to the use of the total analyses that are conducted. With the high concentration of TDS recorded in many of the samples, the iron and manganese in the sediment as well as the dissolved constituent is reported. There is little evidence to support this conclusion because TSS levels were not analyzed, not recorded, or were too low to register, for many of the high iron and/or manganese samples. The manganese concentration reported for samples from Well GW-10 range from 0.01 to 0.08 ppm except for one sample taken 10/88 which shows a concentration of 1.38 ppm. This is an approximate 25 times increase for the one sample. After 10/88 the measured concentrations of manganese returned to the normal levels of 0.01 to 0.05 ppm. It would appear that the 10/88 sample was anomalous. Well GW-9 also exhibits the same type of extreme variability.

Monitoring wells GW-10 and GW-11 are very close together yet they exhibit an unusually large variation in sample results. The 9/90 sample for GW-10 showed a manganese level of 0.04 ppm while the 9/90 sample for GW-11 showed a value of 0.69 ppm or 17 times higher than for the GW-10 sample. GW-10 and GW-11 are just over 250 feet apart. There are other examples of wide ranges of manganese sample analyses over time and location.

The same kinds of anomalies can be found in the sample data for iron analyses. For example, typical iron concentrations for GW-14 samples range from 0.01 to 6.57 ppm. However, the sample for 5/87 indicated a value of 140 ppm, an increase of 40 times over the typical values. GW-1 shows typical values of 0.01 to 9.18 ppm iron, however the 3/88 sample indicates and iron concentration of over 96 ppm, a 20 times increase over typical values. Sampling data as recent as 3/91 also shows an iron value of 28 ppm which is 5 times the typical values.

The data presented herein contain other anomalous results with no apparent reason for their variation. Throughout the ground water analysis it has been puzzling to find such extreme variation in ground water conditions. As a whole, such variation is not typical and not reasonable for the local ground water characteristics. The reason for the anomalies discussed above is unknown and at present can only be explained by sampling, reporting or analytical error. This is especially true since the loadout facility was idle between the year 1984 and 1989.

Given the data problems described above, the more recent data set analyzed as part of the Covol amendment was tabulated and analyzed separately. However, it is still difficult to make definitive statements regarding trends or variations in the data. In general, the more recent data reported in the more recent Table 7.24-3a showed values that were within the range of the previous data. Since 1991, the TDS concentrations at GW-1 and GW-3 appear to have increased over time, while TDS at GW-2, GW-4 and GW-6 have apparently at least minimally decreased during the same time period, most notably at GW-2. GW-2 and GW-3 still report widely disparate TDS values even though they are located quite close to each other.

#### 7.24.2. SURFACE WATER INFORMATION

#### WATER RIGHTS

A search of all the surface water rights located within a three mile radius of the permit boundary was conducted. These water rights are summarized in Table 7.24-4, with an accompanying map which shows the location of each water right.

## WATER QUALITY

Surface water quality data have been collected in the area of the load-out facility since 1985. This data collection activity has been conducted by several different owners and sampling firms. Since no information is available about the methods used to sample the surface water a anion/cation balance test was applied to all of the surface water samples. Milliequivalent values of the anions and cations in each sample were summed and the percent difference calculated. If the percent difference between the cation sum and the anion sum exceeded 10 percent the data for that sample were assumed to be in error. The surface water sampling protocol, used since December, 1989, consists of collecting the water samples in accordance with the procedures stated in the Guidelines for Establishment of Surface and Ground Water Monitoring Programs for Coal Mining and Reclamation Operations, the Division, 1986. A copy of the Water Quality Parameters can be referenced in Table 7.24-5.

The surface water quality data, collected from 1985 through mid-1991, have been entered into the Division's electronic water quality database compiled and summarized in Table 7.24-6 and plotted on Figures 7.24-1 through 7.24-6. Data for surface water sites SW-1, SW-2 and SW-4 from mid-1991 to mid-1997 have been entered into the Division's electronic water quality database. are summarized in Table 7.24-6a. Data from this latter period for SW-3, SW-5, SW-6 and SW-7 are not included because no flow was recorded at those sights in recent years. These summaries contain a listing of all water quality data for each sample site. Sample results assumed to be in error because of the anion/cation imbalance have been separated in the table from the sample data assumed to be good. Basic statistical evaluations, consisting of maximum, minimum, mean, standard deviation, and number of analyses, of each parameter was conducted for the data assumed to be good. The erroneous sample data contain the word "Error" in the Comment of the table and are listed below the data statistical summaries discussed.

# TABLE 7.24.2 GROUND WATER QUALITY PARAMETER LIST

PARAMETERS	BASELINE	OPERATIONAL*
FIELD PARAMETERS		
Flow or Water Level (gpm/ft)		
Specific Conductivity (µS/cm)		
Temperature (°C)		
pH		
LABORATORY PARAMETERS		
Ammonia (NH <sub>3</sub> )	<b>新</b> 了一次,一个人们的一个人们的	
Alkalinity (Carbonate)		
Alkalinity (Bicarbonate)		
Alkalinity (Total)		
Aluminum Dissolved		
Arsenic Dissolved		
Boron Total		
Boron Dissolved		
Cadmium Dissolved		9
Calcium		
Chloride		
Copper Dissolved		
Total Hardness		
Iron Dissolved		
Iron Total		
Lead Dissolved		
Magnesium		
Manganese Dissolved		
Manganese Total		
Molybdenum Dissolved		
Nitrate		
Nitrite		
Oil & Grease		
Phosphate (Orth.)		
Potassium		
Selenium Total		
Selenium Dissolved		
Sodium		
Sulfate		
Zinc Dissolved		
Н		(removed parameter)
Specific Conductance		(removed parameter)
Total Dissolved Solids (T.D.S.)		
Cation/Anion Balance		

7.24

# **TABLE 7.24.5**

# SURFACE WATER QUALITY PARAMETER LIST

PARAMETERS	ATER QUALITY PARAN BASELINE	OPERATIONAL*
FIELD PARAMETERS		
Flow or Water Level (gpm/ft)		
Specific Conductivity (µS/cm)		
Temperature (°C)		
Н		
LABORATORY PARAMETERS		
Ammonia (NH <sub>3</sub> )		
Alkalinity (Carbonate)		
Alkalinity (Bicarbonate)		
Alkalinity (Total)		
Aluminum Dissolved		
Arsenic Dissolved		
Boron Total		
Boron Dissolved		
Cadmium Total		
Calcium		
Chloride		
Copper Total		
Total Hardness		
Iron Dissolved		
Iron Total		
Lead Total	White the second	Control of the contro
Magnesium		
Manganese Dissolved		
Manganese Total		
Molybdenum Total		
Nitrate		
Nitrite		
Oil & Grease		
Phosphate (Orth.)		
Potassium		
Selenium Total		
Selenium Dissolved		
Sodium		
Sulfate		
Zinc Dissolved		
рН		(removed parameter)
Specific Conductance		(removed parameter)
Total Dissolved Solids (T.D.S.)		
Total Settleable Solids		
Total Suspended Solids		
Cation/Anion Balance		

<sup>\*</sup>OPERATIONAL AND POST MINING

7.24

**8.** [R645-301-724.400]: Climatological Information. This section requires climatological information of the permit area. Seasonal temperature ranges were provided; however, seasonal precipitation ranges and prevailing wind direction and velocity information were not. The information provided in the MRP lists only the average annual precipitation total. Please provide seasonal precipitation averages, prevailing wind direction and velocity information. (AA)

## MRP Insertion Instructions:

- Sec. 7.24, p. 5, 11/20/12 of this submittal replaces
- Sec. 7.24, p. 5, 09/10/97 of the Division's copy of the MRP

In order to improve the nature of the water quality data it is proposed that the sampling and analysis process be refined. Refinement will include training to the designated sampler and a review of the water quality laboratory completing the analyses. Through this process, the older more questionable data will be replaced by recent and future, more uniform, and accurate sampling data.

#### 7.24.3 GEOLOGIC INFORMATION.

Geologic information is present in Section 600. This information was used to develop the probable hydrologic consequences.

#### 7.24.4 CLIMATOLOGICAL INFORMATION.

Average annual temperature for this area is 49.4 °F with a range of -21° to 107 °F. The average temperature during the warm months is 63.9 °F and during the cold months is 34.9 °F. Average annual precipitation is 9.59 inches. Seasonal precipitation ranges at the facility are summarized below (1980-2005 data from the Wellington 3E weather station 429368 located 0.7 miles north of the facility).

	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
Precip. (in.)	0.62	0.57	0.76	0.74	0.76	0.51	0.78	1.09	1.29	1.02	0.49	0.49
Snowfall (in.)	6.4	4.2	1.8	0.5	0	0	0	0	0	0.3	2.6	4.7

The prevailing winds at the nearby Price weather station are from the north (18% of the time), northwest (13% of the time), northeast (11% of the time) and from the south (8% of the time), with wind speeds typically ranging from 0 to 19 mph, rarely exceeding 26 mph (see station data 1999-2012).

#### 7.24.5 SUPPLEMENTAL INFORMATION.

#### 7.24.6 SURVEY OF RENEWABLE RESOURCE LANDS.

Information obtained from the ground water monitoring wells within the permit area suggests that there is an aquifer perched at the interface of the surface alluvium with the underlying Blue Gate Shale. The shape of the piezometric surface as shown on Map E9-3451 indicates that the primary source of recharge is north of the permit area.

Mining of native, in-situ material does did not occur within the permit boundary so there is no subsidence. The mining that will occur occurred under Covol's operations simply involves involved removing waste coal refuse placed by previous operators, so there will be was no potential for subsidence as a result of that operation. There area no excavations at the operation which penetrate to the aquifer, except for the monitoring wells. It was concluded that because of these limitations the operation within the permit area will would not disrupt the aquifer except as described in Section 7.28. The primary recharge area for the aquifer is off the permit area to the north.

#### 7.24.7 MEET REQUIREMENTS OF 302-320

Information regarding Alluvial Valley Floors as presented within Section 2.0 and other sections of this MRP has been summarized herein.

The Wellington Coal Loadout Facility appears to be located on alluvial deposits and there is evidence of historic flood irrigation to fields between he DRG&W Railroad and the Price River. Subirrigation in this area is however not highly beneficial because of poor ground water quality.

Section 2.20- entitled "Environmental Description" indicates that the general map unit of soils encompassing the Wellington Plant Site is the Ravola-Billings-Hunting unit. The soils distribution is shown on Figure G9-3510. This map unit is described as:

**9.** [R645-301-724.600]: Survey of Renewable Resource Lands. This section discusses COVOL operations in the present tense and should be updated. (AA)

## **MRP Insertion Instructions:**

- Sec. 7.27, p. 1, 11/20/12 of this submittal replaces
- Sec. 7.27, p. 1, 12/05/97 of the Division's copy of the MRP

## 7.27 Alternative Water Source Information (R645-301-727)

The owner/operator owns approximately 10 cubic feet per second of water rights in the Price River for industrial and irrigation uses at the Wellington Facility. While the cleaning plant is not in operation the water usage for the facility is limited to small quantities. Previously, in conjunction with the Covol Wash Plant operations, However, the owner/operator has committed in a lease agreement to provide Covol with up to 5 cubic feet per second of water from those water rights for operations at the Covol Wash Plant. Under current planning. As discussed further in Section 7.28 of this Chapter, Covol under its maximum water needs in Phase 1, expecteds to use about 4.6 cfs of water pumped from the Price River collection well and/or the river diversion to the river pumphouse. During the bulk of operations in Phase II, water usage was planned to will be much less than during Phase I, averaging around 2 cfs on an annual basis, with pumping rates closer to about 3 cfs during summer months. The balance of the water rights are were available for other activities if necessary at the plant.

The ownership and use of water under these water rights is covered by the State of Utah water laws and administered by the Division of Water Rights, State Engineers Office. The use of the Price River water is monitored year-round by a water commissioner employed by the Price River Water Users and appointed by the State Engineer. In the event that the owner/operator's actions result in diminution or interruption to the water rights of a legitimate water userd, the owner/operator will make available water from the owner/operator owned or controlled water rights during the diminution or interruptions.

The quality of the Price River water is administered by the State Department of Health Utah Department of Environmental Quality. In the event that the quality of water becomes unsuitable for use by a legitimate water user due to actions by the owner/operator, the owner/operator will make available water from owned water right during the period

10. [R645-301-727]: Alternative Water Resource Information. This section discusses a water right held by the Permittee for water from the Price River. The section also discusses a lease agreement with COVOL. This section should now be updated to reflect historic water usage when COVOL operated their facility. Paragraph 3 also lists the State Department of Health as the regulatory authority over the Price River. This should be changed to the Utah Department of Environmental Quality. (AA)

## **MRP Insertion Instructions:**

No insertion needed, addressed above

11. [R645-301-728]: Probable Hydrologic Consequences (PHC). Based on ongoing discussions with the Permittee and their hydrologic consultant, it was agreed that a revised PHC should be prepared for the site as part of the 2012 midterm permit review. (AA)

The Redline/Strikeout version from the November 20, 2012 submittal has been retained in this document. Changes to this version made in the January 31, 2013 submittal has been printed in blue font.

## MRP Insertion Instructions:

- Sec. 7.28, p. 2, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.28, p. 2, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 8, 11/20/12 of this submittal replaces
- Sec. 7.28, p. 8, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 8a, 11/20/12 of this submittal replaces
- Sec. 7.28, p. 8a, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 15, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.28, p. 15, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 20, 11/20/12 of this submittal replaces
- Sec. 7.28, p. 20, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 21, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.28, p. 21, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 21a, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.28, p. 21a, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 22, 11/20/12 of this submittal replaces
- Sec. 7.28, p. 22, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 25, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.28, p. 25, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 28, 11/20/12 of this submittal replaces
- Sec. 7.28, p. 28, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 29, 11/20/12 of this submittal replaces
- Sec. 7.28, p. 29, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 30, 11/20/12 of this submittal replaces
- Sec. 7.28, p. 30, 10/20/97 of the Division's copy of the MRP
- Sec. 7.28, p. 30a, 11/20/12 of this submittal is <u>added</u> to the Division's copy of the MRP

#### 7.28.2 BASELINE INFORMATION

The Wellington Coal Loadout facility is located approximately one to two miles east-southeast of wellington, Utah adjacent to the Price River. The permit area is located in parts of Sections 8 through 10 and 15 through 17 of Township 5 South, Range 11 East (as indicated on Drawing G9-3507). The site has previously been operated as a coal preparation and wash facility by both U.S. Steel Corporation and Kaiser Coal Corporation. Originally constructed in 1958, the preparation plan was operated more or less continuously until approximately 1984. Castle Valley Resources acquired the property on August 2, 1989.

Present site facilities consist of a wash plant, loadout, a coarse refuse pile, a temporary pond coarse slurry pile and fine refuse basins, as indicated on Drawing E9-3341. Castle Valley Resource plans to operate the loadout portions of the facility and to reclaim the fine refuse basins. The loadout is expected to receive and ship 500,000 tons of coal from the Genwal Mine annually. Covol intends to construct and operate a modular coal fines wash plant, power lines and water and tailings pipelines in the coal refuse ponds area (Drawing 712a and T1-9597) in order to reclaim fine coal from the existing fine refuse ponds.

## **GEOLOGY**

Surficial geology in the facility area has been presented on map C9-1213R. All of the valley bottom areas occupied by the loadout facility and the fine refuse pile is mapped as alluvium associated with various depositional environments (i.e., river alluvium, or slope wash). The hills that rise adjacent to the Price River have been mapped as Blue Gate Shale, a member of the Mancos Shale. Beneath the Blue Gate Shale, is another member of the Mancos Shale, the Ferron Sandstone.

Ferron Sandstone. The Ferron Sandstone is a regionally extensive member of the Mancos Shale. In the area of the loadout, the Ferron Sandstone appears to be located at a depth of approximately 400 to 450 feet below the surface. Based on the water rights data, few wells, if any, are completed in the formation in the area adjacent to the loadout.

Blue Gate Shale. The Blue Gate Shale has been observed at all locations drilled through the alluvium in the area of the loadout. In addition, the Blue Gate shale is exposed in all the hills that rise above the loadout and fine refuse basins. Therefore, it is concluded that the Blue Gate Shale is continuous beneath the alluvial deposits and over the Ferron Sandstone in the loadout area. As is typical of the marine shales of the Mancos Shale, the Blue Gate Shale, in the area of the Wellington loadout, is gypsiferous. The presence of salts in the area is indicated by salt deposits found at or just below the crest of hills or high points in the Blue Gats Shale or shale-derived soils. These salts are soluble by rainfall and can be conveyed to either surface water or the ground water system.

alluvial quality typical of the higher permeability zones found at other locations. For these reasons it was decided to cease the collection of water quality data from this station.

It has been determined that well GW-3 may monitor upstream and downstream refuse pile water quality depending upon water level conditions. Cross section analysis shows that the Siaperas Ditch acts as a local ground water drain and may reverse local water gradients from the south to the north when water within the well rises to about the 20.6 foot level. When the water level is below this point, flow will generally continue to the south with some potential impacts on water quality.

With the above-described changes to the monitoring plan, all potential ground water impacts from the CWP will be adequately described; no additional new wells are planned or needed to cover the CWP operations. However, additional parameters (BTEX N and propylene glycol) will be measured at GW 4 and GW 6 beginning with the third quarter of 1998. These constituents area contained with the frothing and flotation agents used at the CWP. They are not expected to be present in samples obtained at GW 4 and GW 6, but their inclusion in the parameter list for those sites will provide the means to determine the potential for adverse impacts to the hydrologic balance.

In addition, to provide supplemental information, water samples may occasionally be taken from the water supply well located in the Price River alluvium in order to document the surface-groundwater relationship of Covol's water source with the Price River; results from any such sampling will be submitted to UDOGM along with the required monitoring reports.

#### SURFACE WATER

The WCLF and the CWP are located within the central portions of the State of Utah within the Price River drainage. The Price River drainage is located mainly in Carbon and Emery counties and comprises and approximate drainage area of 1,900 square miles. The Price River drains the north end of the Wasatch Plateau and the western portion of the Book Cliffs. As the water flows to the south it is diverted in an east-southeast direction around a locally present geologic dome (the San Rafael Swell).

Regional drainage basin topography ranges in altitude from 10,443 feet within the headwaters of the Price river at Monument Peak to about 4,200 feet at the confluence of the Price and Green rivers. Precipitation over the entire drainage basin varies greatly due to changes in elevation. According to Utah Division of Water Resources (1975), normal annual precipitation can be in excess of 30 inches at higher elevations and less than 8 inches at lower elevations. Most of the annual precipitation which falls within high basin elevations occurs between the months of October and April as snowfall.

Surface water resources within the area of the loadout and the CWP include the Price River which flows diagonally, northwest to southeast through the permit area (see Drawing F9-177) and several ephemeral drainages which are tributary to the Price River. Price River flows recorded by the USGS at the loadout facility are presented in Table 7.28-3.

Surface water sampling stations established by the applicant for the monitoring of the surface water system include stations identified as SW-1 through SW-8 on map E9-3451. Stations SW-1 and SW-2 are located on the Price River upstream and downstream of the facility respectively. Stations SW-3 and SW-6 are both located in undisturbed areas east of the Upper Refuse Basins. SW-4 is located on the lower Siaperas Ditch before its confluence with the Price River, and SW-5 and SW-7 are located at the outlets of the Upper Coarse and Fine Refuse Basins respectively. SW-8 is located west of the Price River in the area of the main operations facilities.

Of the stations monitored, data records indicate that station SW-3 has not experienced flow during the life of the station. SW-3 is located on an undisturbed ephemeral drainage upstream of the tailings ponds.

Sampling records for stations SW-4 through SW-7 indicate that between late 1985 and early 1988 flow at these sites transitioned from perennial to ephemeral. This transition was due to 1) the cessation of operations at the preparation plant, 2) the associated cessation of discharge to the tailings ponds, and 3) a natural decrease in precipitation and associated runoff. As the source of the water in the tailings ponds diminished through either evaporation of seepage, the flows recorded at the surrounding stations declined. Under the recent runoff configuration, surface stations SW-3, SW-4, SW-6, and SW-8 were expected to receive runoff only following a precipitation event and stations SW-5 and SW-7 will note runoff only following a major precipitation event. Stations SW-5, SW-6 and SW-7 are likely to again experience more frequent flows as water used in the dredging process and water contained in the redeposited tails is decanted from the Northwest Pond to the Upper Refuse Pond, then to the Lower Pond and finally to the Clearwater Pond. Flow variations for Stations SW-1, SW-2 and SW-4 are shown in Figure 7.24-6. No flows are available for the other stations monitored.

In addition to the parameters listed in Table 7.24-5 for the basic surface water monitoring, BTEX-N and propylene glycol will be measured at SW-4 and SW-5 beginning with the third quarter of 1998. These constituents are contained with the frothing and floatation agents used at CWP. Their inclusion in the parameter list for these two surface water sites will provide the means to determine the potential for adverse impacts to the hydrologic balance.

## **Uses and Rights**

The Price River is a perennial stream used as a supply for domestic, irrigation, and stock watering purposes. Because of rapidly decreasing water quality within the lower reaches of the river system, domestic or municipal uses of the Price River are generally confined to upper stream reaches. Irrigation and stock watering uses occur throughout its length. A listing of water rights was provided earlier within the hydrologic section of this permit application.

Operation of the CWP will require up to 5 cfs of water obtained from the river water collection well near the Price River and/or the river diversion to the river pumphouse. Water rights associated with this water belong to Genwal and are being provided to Covol as part of their lease agreement with EarthCo.

#### Seasonal Fluctuations

Streamflows in the Price River fluctuate seasonally in response to the seasonal variations in precipitation and temperature. Waddell, et al. (1981) reports that 50 to 70 percent of the streamflow from the Book Cliffs and Wasatch Plateau occurs during the period between May through July as a result of snowmelt and spring runoff, with most of the flow originating from the Wasatch Plateau drainages. The USGS (1990) maintained a stream gaging station on the Price River below Miller Creek near Wellington, Utah for the period between 1972 and 1986. The station was discontinued in 1986. Stream flow data for the available period of record has been reproduced in Table 7.28-3. For ease of impact analysis associated with Covol's project, from this table has been further analyzed in Tables 7.28-3b and 7.28-3c.

Two stations on the Price River are monitored as part of this MRP, one up- and one downstream of the permit area (monitoring stations SW-1 and SW-2); the streamflow data has been obtained since 1986 is reproduced in Table 7.28-3d.

shown in Table 7.28-4. The location of gasoline based products including diesel and gasoline are shown on Map 712d. The shop building shown on the drawing is also used to house all other oil, grease, antifreeze etc and is used as the site for all truck maintenance. Trucks too large to fit into the shop are cleaned and have their oil changed in back of the shop in the general shaded area as shown on map 712d. Fuel oil and lubricants will also be were stored in the Covol modular coal fines was plant located on Figure 5.12-1. No. 2 Diesel is was added to the coal at the CWP to provide floatation of the coal particles, and is was also used to fuel some of the heavy equipment used on-site. Additional information related to the location of the other surface facilities may be found in Section 5.0.

The impact from spillage during maintenance activities and during filling of tanks will be mitigated by the implementation of the SPCC plan. The gasoline and diesel fuel storage tanks currently constructed without containment structures will be modified as follows. The tanks will be moved and any contaminated soil currently found beneath the tanks will be removed and properly disposed of, after which rectangular concrete bases will then be constructed with volumes adequate to contain the maximum storage potential for the facilities. Designs for the containment of Diesel and Gasoline fuels are included as part of Appendix 7.28-1. It is important to note that the designs can and should be modified to fit both existing and future tanks as required to obtain total containment with an adequate freeboard. It is not the horizontal dimensions but the total volume. Based on the tank volumes provided by the operator of 2,000 gallons diesel and 500 gallons gasoline, the containment facilities must contain a 2,000 gallon spill. The tanks will then be placed in the concrete containment bases thereby preventing the contamination of local soils or ground water during filling. These containment pads will be placed at the same sites as the tanks currently occupy. New hydrocarbon storage tanks associated with the Covol wash plant will be placed within similarly constructed concrete containment pads.

Monitoring well GW-9B, GW-10, GW-11, and GW-12 would be used to evaluate the presence of hydrocarbon product contamination in the event that future spills occur at the loadout facility by sampling for Volatile Organic Carbons. Further, quarterly monitoring of BTEX-N at GW-4, GW-6, SW-4, and SW-5 would be used to determine whether or not the No. 2 diesel is adversely impacting surface or ground waters.

Table 7.28-4
Potential Sources of Hydrocarbon Contamination

Contamination Source	Comment
Dust Suppressant	• This material consists of soap and water, is used on coal piles, and is located in
	55 gal. drums housed in storage building.
	During summer periods, water is sprayed on roads as a dust suppressant.
	During winter periods salt is applied to the road between the property gate and
	the coal piles.
Maintenance Operations	Performed at fueling station
• On site	
Oil	• For Covol's operations, oil will also be stored at the plant site in a 10,000 gallon
• Storage	above ground tank.
• Deposition	• Very minor amounts of diesel, which is bound to the refuse, ins returned to the
	Northwest Pond and the Upper Refuse Basin.
Underground storage tanks	None located on site.
Waste Disposal	• Septic tank system with drain fields. Drain field lies Northwest of main Office.
• Liquid	Contracted to "City Sanitation".
• Solid	

# Other Reagents

The CWP uses used two agents in processing coal in addition to the No. 2 diesel discussed above. CM-630 Floatation Frother (which consists of tripropylene glycol *n*-propyl ether and propylene glycol *n*-propyl ether) and sodium silicate solution are were stored at the CWP and added to the coal at the floatation cells. The former agent was is used for frothing, and the latter is a de-slimmer. The presence of propylene glycol will be was analyzed quarterly at monitoring sites GW-4, GW-6, SW-4 and SW-5 through the 3<sup>rd</sup> quarter of 2012. Results from those analyses were would be used to determine whether or not these reagents area adversely impacting impacted surfaces or ground waters.

## Water Reduction or Diminution

The impacts to the hydrologic balance are discussed within the following section.

# 7.28.3.1 Impacts to the Hydrologic Balance

As presently envisioned, the operations of the Wellington Loadout facilities will not be water intensive; therefore, it is not believed that significant impacts will occur from EarthCo's the facilities operations to the surrounding water levels. Some minor impact however may result form from a reduction in runoff as surface water flows are contained.

within surface impoundments which are required by the regulatory agency to control water quality. These effects however are believed to be of minor significance since runoff only occurs in response to local rainfall, and since rainfall within the general area is small. The majority of water found within the area is from limited aquifer resources and flows within the Price River. As with other areas of the region and State, current declines in water level and or river flow are believed to be the result of climatic variations and not lodout opoerations. However, in the unlikely event that a significant diminution in water level in the surrounding wells or in the stream flow were to be caused by the EarthCo Wellington Loadout operation, Earthco the owner/operator will replace the water with on-site water which they have access to. through agreements with the underlying water right owners, NEICO, Genwal, and IPA. It must be remembered that this possibility is highly unlikely since no changes in EarthCo's the facilities operation are planned which could possibly impact the local water resources.

Covol's operations will be more water intensive. Water in amounts up to 5 cfs will be supplied to Covol by EarthCo, from water they control under agreements with owners of water rights #91-215, #91-216, #91-371. Section 7.24 provided a tabular water rights summary that included information on these rights. These three water rights combined have a total flow of approximately 20 cfs, with a yearly total withdrawl limit of about half that (7,297 acre feet per year). Year round, industrial use of this water is allowed under these appropriations. In the watewr balances associated with Covol's three year mine plan, they propose to use water at the yearly rates shown below in Table 7.28 4a. The water use projections have included averaged estimates of precipitation, runoff, and in situ moisture as additional water inputs, and evaporation and seepage as additional water losses. The details, including assumptions, for the spreadsheet water balance calculations are included in Appendix WB. The calculated plant water usage includes approximately 500 gallons per day for road watering as needed.

Table 7.28 4a
Summary of Projected Water Use by Covol
(in gpm and afy, annual averages)

OPERATIONAL CASE	Water Used by Covol		
Phase 1 (initial startup)	<del>2045 gpm</del>	3299 afy	
Phase II Year 1	710 gpm	<del>1145 afy</del>	
Phase II Year 2	<del>787 gpm</del>	<del>1269 afy</del>	
Phase II Year 3	852 gpm	<del>1374 afy</del>	
Design Case (assuming 0 precip	<del>1282 gpm</del>	<del>2067 afy</del>	
and summer evaporation rates)			

Although Covol's operations will result in an increased use of water over that occurring in recent years, these general levels of water from these sources and at similar rates have been previously used at the site for similar operations. Additionally, the proposed uses, sources and quantities of water area allowable and appropriate beneficial uses for the water rights to be used. Therefore, diminution of water occur that could affect other water rights should not occur.

The existing ground water monitoring network was will continue to be used to monitor fluctuations in the ground water surface and predict potential impacts due to loadout operations and mining and operations associated with the CWP. The surface water sampling sites SW-1 and SW-2 were will be used to evaluate the impacts of both operations on the surface water resources of the Price River which passes through the area.

#### 7.28.3.3 Impacts by Mining or Reclamation

#### Sediment Yield from Disturbed Areas

The impacts which could result from additional sediment contamination are decreased surface water quality in the Price River. The quality decrease would occur as increased TSS, TDS, and salt concentrations for downstream flows. Such impacts could reduce the usability of the flow for downstream irrigation and stockwatering.

These impacts are controlled at the Wellington loadout, including the area under lease by Covol, through the use of adequately designed runoff control structures. As previously installed, the runoff control structures for the Wellington loadout capture and treat all runoff from disturbed lands before it is released to the Price River. A review of the runoff control plan and structures for the entire permit area was recently completed by Hansen, Allen & Luce, Inc. and is included within the permit in Sections 7.32, 7.33, 7.34, 7.42, and 7.43, and as shown on Drawing F9-177. The basic plan includes the diversion of all undisturbed areas away from disturbed areas and the collection and retention of all other areas into sediment ponds or alternate sediment control structures (ASCA's). Similarly, at the Covol coal fines wash plant, sediment and runoff will was designed to be controlled by site grading, drainage ditches, and culverts. The main plant site pad will be graded at 2 percent, with all runoff directed to the Lower Refuse Basin sediment pond. Upgradient runoff will be directed around the pad with structures as described in Section 7.42. In addition, interim revegetation and erosion control matting will be place on the steep fill slopes associated with the column pad and the east side of the main pad area. The sediment ponds have been designed to contain runoff until effluent limitations are met, and runoff treated by ASCA's is limited to small areas which contain limited activity.

#### Water Quality Impacts

Overall impacts to water quality as a result of mining were identified in the discussion related to the spacial water quality time plots discussed in Section 7.28.2. According to information contained in the previous section, the acid base potential for materials found within the refuse ponds is low, and consequently little water quality impact is expected to occur as a result of acidity either during operations or during reclamation. Similarly, analyses of a washed tails sample (Appendix WT) from Covol's bench scale testing showed low acid base potential, and represents the expected acid base potential of replaced tails after Covol's processing. The reported results from EP toxicity tests on the in-place coal fines refuse deposited by U.S. Steel indicated that the material does not generate toxic leachate. Covol's initial bench scale test samples (Appendix WT and Appendix TW) indicate that the washed tails would not generate toxic leachate either. The leachate of the Covol tails was analyzed through standard soil past extract procedures, which is a 24-hour leach with water. Further, chemicals added to the tailings as a result of Covol's processing will be surfactants/flocculents which are used at low, environmentally benign, concentrations (See Appendix MS for the Material Safety Data Sheets for the reagents to be used).

The flotation agents to be used in the plant will include propylene glycol of various molecular weights, No. 2 diesel, and sodium silicate. Calculations have been made of the concentrations of those reagents in the resulting wash planta tailings and show that they will vary from less than 10 ppm for the glycol and diesel to approximately 110 pm for the sodium silicate (See Appendix MS for these calculations). MSDAs for these reagents indicate that none of these reagents are listed in EPA designations for hazardous substances (40 CFR 302.4). In addition, the waste stream containing these agents will not be hazardous waste under EPA regulations (40 CFR261.2). Both the glycol product and the diesel are biodegradable and there concentrations in the waste area are expected to naturally reduce over time. Based on the non-toxic nature of the plant floatation agents, no special spill control plans, other that the existing SPCC plan, will be necessary. Information obtained from the supplemental quarterly monitoring of BTEX-N and propylene glycol that will be implemented in the third quarter of 1998 as sites GW 4, GW 6, SW 4, and SW 5 will be used to verify the concentrations of those substances.

- Operations ceased adding material and water to the slurry ponds in the early 1980's. The only water currently entering the ponds is through rainfall or natural runoff, neither of which contain high mineral contents which could potentially occur in slurry water. Beginning with initial startup of the CWP operations, water pumped from the nearby river water collection well and/or the river diversion to the river pumphouse, and plant tails from the wash plant will enter the slurry ponds. Water will be pumped to the ponds at an average rate of between 710 and 1,282 gpm, and tails will be slurried to the ponds at an average rate 41.9 stph and 4070.7 gpm. Water quality information for a sample of washed tails water obtained from a bench scale test, and results from a soil paste extraction analysis of the solid component of the waste from the bench scale test has been added to Appendix WT and Appendix TW, respectively. As shown, the washed tails water has a total dissolved solids content of 1,500 mg/l, reflecting the same general level of mineral content as the Price River source water.
- Decreased inflows experienced since operations ceased have translated to a decreased leaching potential of
  slurry materials. Once the CWP operations begin removing the existing slurry, and providing increased
  inflows of water and reworked tails, leaching potential will change. During operations, there will be and
  increased in water applied to the pond, with a consequent increase in leaching potential. However, the net
  effect of the operations will be to reduce the volume and surface area of slurry materials in the ponds,
  reducing the material that can be leached. The leaching potential of the existing in place tales is expected
  to be the same as under former U.S. Steel's operations.
- Supplemental monitoring for the presence of BTEX N and propylene glycol (additives used in processing at the CWP) will allow for determination of quality impacts to water resources.

Reclamation. Water quality impacts as they relate to reclamation activities will be minimal because runoff and sediment control will be designed and maintained to prevent surficial loading to the Price River. Should sediment control fail, water quality impacts include the potential for increased sediment loading to the Price River during the initial phases of reclamation disturbance, and by toxics including boron and selenium. As can be seen by the data presented in Table 7.28-7, boron exceeds the acceptable limit of 5 mg/l in at least one depth sample at all six SP Stations. As stated earlier within this chapter, as well as within Chapter 2, high boron concentrations can be of concern due to the potential limiting impact upon plant life. A discussion regarding successful plant growth on test plots wherein SP soils were used can be found within Chapter 2. The remaining question regarding the control of boron then relates to the potential for boron to leave the site via ground water migration and thereby impact neighboring vegetation systems. An evaluation of data found in Table 7.28-7 shows that all SP stations experience a decreasing concentration of boron with depth. This anomaly was explained in a personal communication in 1994 between Hansen, Allen & Luce, Inc. and Mt. Nebo Scientific as a natural occurrence resulting from evapotranspiration. The end result is that the most concentrated amounts of boron will be found within the upper most soil layers thereby limiting the potential for leaching into the ground water system

Upon reclamation, it is proposed to create a roughened surface which will mostly contain and control rainfall runoff. Rainfall captured by this roughened surface will be mostly absorbed into the soil matrix and become available for the support of vegetative growth. During summer months, little rainfall contribution to the local ground water table is believed possible due to the typically high evapotranspiration rates documented in the "Hydrologic Atlas of Utah" prepared by the Utah Department of Natural Resources and Utah State University. (Although the summer months of July, August and September provide, on average, the highest rainfall amounts, much of this rainfall would be expected to evaporate and/or run off surficially.) The greatest potential for rainfall contribution to the ground water table would characteristically be in the winter between the months of November and March when evapotranspiration rates are at a minimum. Even during the winter months however recharge and leaching potentials will be hampered because of freezing conditions which will slow overall infiltration. Under either scenario, boron concentrations are expected to be similar in nature to those currently measured at monitoring stations in that concentrations decrease with depth. The end result is that little to no transport via either surface or ground water is expected to occur, and vegetation will continue to grow as documented in test plot studies.

- A large quantity of runoff water that currently enters the basins will be diverted through a permanent diversion ditch. This reduction of water will limit the amount of leaching possible to the amount of rainfall which falls directly on the respective basins.
- The land surface will be roughened to encourage and promote infiltration of rainfall. This localized capturing of the water is believed to be critical to the establishment of successful vegetation. As vegetation grows, additional water will be used within the upper soil layers to support the vegetation thereby reducing the total amount of leaching possible.
- A review of precipitation and evaporation records discussed earlier indicates that the annual amount of evapotranspiration significantly exceeds the amount of rainfall to the region.

#### Flooding or Streamflow Alteration

No streamflow alteration has occurred to the Price river which traverses through the middle of the permit area, nor has any hydrologic modification been made which would impact the flooding potential of the Price river. To the contrary, it is believed that the flooding potential within the disturbed areas of the permit has been reduced with the installation of surface impoundment structures as discussed previously. Because of a change in operation since 1984, many of the runoff control ponds have capacities far in excess of local requirements. Even with operation of the CWP, required capacities were will be maintained. Although this retention of water produced from precipitation at these areas will reduce the total amount of runoff which would normally enter the Price river in the absence of the loadout facility, the overall impact should be negligible because of the small amounts of rainfall runoff which would normally occur throughout the year in comparison of annual Price river flow volumes.

Pumping of up to 5 cfs of water from the river water collection well near the Price River and/or the rivers diversion to the river pumphouse is would likely to have a similar level of impact on river flows as during U.S. Steel's former operations.

#### Ground-Water and Surface-Water Availability

Probable hydrologic impacts upon surface and ground water availability will be related to use of up to 5 cfs of water from the Price River. This water has previously been appropriated for use at the site, and its use will continue to be overseen by the State Engineer's office to insure that it will not negatively affect other water right holders. According to information provided earlier it also appears that the local ground water basin was being benefitted by previous operations through the dilution of the highly saline local waters. Since the operations have ceased which caused this dilution, the ground water appears to have returned, or is returning to background or natural levels. As operation of the CWP continues, it may be expected that infiltration of the water portion of applied tails and makeup water to the local ground water basin will again occur, and provide a similar dilution effect. Additional information related to water quality conditions or trends can be found in Sections 7.24 and 7.28.2.

Since 1) water quality variations resulting from the facility are believed negligible, 2) neither surface or ground water is used for domestic purposes, and 3) ground water levels appear unimpacted by surface operations, little or no impact upon local domestic, agricultural, or industrial systems is anticipated.

#### **Adequacy of Existing Monitoring Plan**

It is believed by the applicant that the current water quality monitoring plan is adequate to define and document current, and monitor future impacts to the surrounding surface and ground water systems with modifications noted below.

The supplemental monitoring of BTEX N and propylene glycol at GW 4, GW 6, SW 4 and SW 5, that will be initiated in the third quarter of 1998, will provide additional measures whereby impacts from CWP operation can be assessed. As part of the monitoring plan, samples of ground water and surface water have been collected at sites GW-4, GW-6, SW-4, and SW-5 for analysis of BTEX-N and propylene glycol. The BTEX-N monitoring at these sites began in the third quarter of 1998 and has continued through the third quarter of 2012. These parameters were analyzed to monitor for the potential presence of these substances in ground waters and surface waters at the site resulting from the use of additives in Covol's wash plant operations. At the time the BTEX-N and propylene glycol monitoring was first recommended, it was considered unlikely that these constituents would be detected in the monitoring wells. These compounds were never detected in significant concentrations and these compounds have not been used at the facility since Covol's operations ceased in 1999. Accordingly, the monitoring of BTEX-N and propylene glycol at these monitoring stations is no longer included in the monitoring plan.

Some unexplained variation in water quality results have been noted and some potential errors in sampling, reporting and/or analyzing have been documented historically. Plans to improve the water quality monitoring program include additional on site education of persons responsible for collecting the appropriate samples, the collection of boron and selenium samples at each ground water site, a review of the track record and capabilities of the analytical laboratory, the installation of two new wells to replace existing wells GW-2 and GW-5 and, the "same day" collection of water samples.

The collection of "same day" water samples is especially critical at surface stations SW-1, SW-2, SW-4 since the time of travel between stations is measured in minutes rather than days, weeks or months as it is in ground water situations. It is believed however by the Operator that the interaction between surface and ground water sources is sufficiently slow that collection of "same day" ground water samples at GW-3, GW-6, GW-15 and GW-16 is not warranted. However, at the request of DOGM, and to increase efficiency, the Operator will attempt to collect samples at stations SW-1, SW-2a, and SW-4, GW-3, GW-6, GW-15, GW-16, and GW-17 on the same day. Should the laboratory be incapable of providing required accuracy, alternatives will be analyzed. Appropriate action will be taken to improve the accuracy and validity of data collected.

Monitoring at site GW-12 is being removed from the monitoring plan. The reasons for the removal are discussed below. GW-12 is located west of the Price River near the historic location of the surface facilities. Currently there are no operational activities at the historic surface facilities area. Well GW-12 is situated between two nearby monitoring wells (GW-7 and GW-14) which are also located west of the Price River and east of the railroad tracks. Because of their close proximity, these two wells can adequately monitor for potential impacts to groundwater systems in the area. Additionally, the region at and immediately surrounding the well location is frequently flooded with surface water runoff from adjacent irrigated farm lands. The ponding of irrigation water at the well location has influenced both water levels and groundwater chemical compositions at the well. These factors limit the usefulness of water level and chemical information collected at the well.

Laboratory pH and Laboratory specific conductance measurements are being removed from the list of laboratory analytical parameters in the monitoring plan for both groundwaters and surface waters. Field pH and field specific conductance measurements are currently included in the monitoring plan for ground waters and surface waters. The field measurements are performed using industry standard field instruments which are regularly calibrated using traceable NIST standard reference material. The results of the field measurements are believed to be reliable and accurate. Accordingly, there is no need to perform redundant pH and specific conductance measurements at the laboratory.

Discharge measurements at SW-2 are being temporarily suspended from the surface water monitoring plan-Currently, no diversions of water from the Price River or discharges of water to the Price River at the facility area are occurring. The likely magnitude of potential contributions (or losses) of flow to the Price River resulting from current activities at the facility is small, and is likely less than the typical error in the flow measurement technique used at SW-2 (current velocity meter and wading rod). The typical measurement error using the alternate "float" method is much greater. Historically there was infrastructure at SW-2 which included an access bridge and cement weir to facilitate accurate discharge measurements at the site. However, at the request of the Division, the access bridge was removed and the stream channel geometry at the cement weir has changed substantially due to erosion of the stream banks at the weir location. As a result of the erosion, poor conditions for stream discharge measurement are now present at the site. Complicating the collection of accurate flow data, water now flows diagonally over substantial portions of the weir rather than in a laminar condition parallel to the channel direction as occurred previously. Additionally, in recent years considerable thicknesses of sticky mud have been deposited along the stream banks and on the channel bottom which makes wading of the stream unsafe. When active operations that could potentially influence flow rates in the Price River resume at the facility, discharge measurements at SW-2 will resume as part of the surface water monitoring plan. It may be necessary to locate an alternate, more suitable location to monitor the river at that time. Surface water discharge rates will continue to be monitored at station SW-2 as specified in the monitoring plan. To increase the safety of monitoring personnel, prudent measures will be taken to minimize safety risks where necessary. These may include the use of a safety rope, using personal flotation devices, and the use of anti-slip footwear. As described in this document, under some conditions when access to the river is considered unsafe, flow measurements in the stream may be performed using the "float" method to minimize the danger to monitoring personnel. When the stream is deemed inaccessible (such as when the creek is icecovered) no measurement will be performed and this condition will be reported to the Division.

#### It should be noted that

Monitoring of water quality in the Price River, both above and below the facility area, will continue as currently detailed in the surface water monitoring plan.

**12.** [R645-301-731.122 and -.222]: Water Monitoring. These sections should be updated based on the outcome of the revised PHC. (AA)

#### **MRP Insertion Instructions:**

- Sec. 7.31, p. 3, 11/20/12 of this submittal replaces
- Sec. 7.31, p. 3, 07/22/98 of the Division's copy of the MRP
- Sec. 7.31, p.3a, 11/20/12 of this submittal should be <u>added</u> to the Division's copy of the MRP
- Sec. 7.31, p.6d, 11/20/12 of this submittal should be <u>added</u> to the Division's copy of the MRP
- NOTE Table 7.24-2 and Table 7.24-5 have been updated and inserted above.

#### 7.31.2. WATER MONITORING

Ground and surface water monitoring are described below. Field measurements collected for both surface and ground water stations are collected with the aid of meters, except for dissolved oxygen which is monitored by use of either a meter or a field test kit using chemicals. Recommended procedures and guidelines for water sampling is attached to this MRP as Appendix 7.31-1. Results of the water monitoring program will be submitted on a quarterly basis to the Division's electronic water quality database. analyzed and submitted on an annual basis by plotting a comparison of Ca, Mg, SO4, Cl, Fe, Mn and conductivity or TDS concentrations with time. Boron and Selenium will be added as new data becomes available since these parameters are now being added to the monitoring list. If deemed necessary or of value, the operator may also include a comparison of climatic factors such as precipitation in order to help document the cause of noted changes.

In addition to the overall monitoring plan, supplemental monitoring will be implemented within the third quarter of 1998 sampling. This supplemental monitoring will be done at two ground water sites (GW 4 and GW 6) and two surface water sites (SW 4 and SW 5). The purpose will be to document the fate of additives that are used within the CWP and that are discharged in low concentrations with the tailing slurry. The parameters monitored at these four sites will be BTEX N and propylene glycol. The BETX N analysis consists of measurements of benzene, toluene, ethyl benzene, xylene, and naphthalene concentrations. These constituents are found within the No. 2 diesel oil that is used to provide flotation in the flotation cells. Propylene glycol is the frothing agent used. Remnants of these additives that are bound with the tailing refuse are discharged back to the refuse ponds at environmentally benign concentrations. There is no designed mechanism for surface release of these agents to Siaperas ditch, however monitoring for their presence at SW 4 may provide an indication of seepage, if any, through the dike and into the Siaperas ditch. SW 5 is within the process circuit; monitoring that site for these reagents will indicate what levels remain in the tailing water after the heavier tailings material have settled out. GW 4 and GW 6 are down gradient wells; resence of these constituents in these wells is not expected, but analytical data will provide a record.

It has been noted that there have been some historic problems with data sampling which the operator desires to resolve. As a solution the Operator agrees that flows monitored as part of the surface water monitoring program will be measured and not listed as "great or lesser than" (unless measurement is not practically possible or due to a hazard to life), and that copies of field data collection sheets will be submitted to the Division upon request.

#### 7.31.21. GROUND WATER MONITORING

A ground water monitoring plan, based upon the PHC determination, as described in Apendix I and Section 7.28, and baseline hydrologic and geologic information has been developed. Prior to 1996, fourteen wells were monitored quarterly for the parameters of Operational Monitoring in Table 3 of the Division's Guidelines for Establishment of Surface and Ground Water Monitoring Programs for Coal Mining and Reclamation Operations. In May 1996, a proposal was submitted to the Division to request the elimination of quality monitoring from site GW-2, total elimination of site GW-5, and the addition of two new well sites, GW-15 and GW-16. Site locations are shown on Dwg. E9-3451.

Well GW-2 will continue to collect water level data.

In November 1997, wells GW-15A, GW-15B, GW-16 and GW-17 were installed and added to the monitoring plan. Their locations are shown on DWG. E9-3451A. GW-15a and GW-15b will monitor undisturbed water in the coal fines. Permeability tests will be conducted on each of these wells prior to February 1, 1998, and results will be reported to the Division.

For reasons discussed in Section 645-301-728, monitoring well GW-12 is being removed from the groundwater monitoring plan.

For reasons discussed in Section 645-301-728, laboratory pH and laboratory specific conductance are being removed from the groundwater monitoring plan.

For reasons discussed in Section 645-301-728, BTEX-N and propylene glycol are being removed as laboratory parameter for monitoring wells MW-4 and MW-6.

For reasons discussed in Section R645-301-728, laboratory pH and laboratory specific conductance are being removed from the surface water monitoring plan.

For reasons discussed in Section R645-301-728, BTEX-N and propylene glycol are being removed as laboratory parameters for surface water sites SW-4 and SW-5.

For reasons discussed in Section R645-301-728, discharge monitoring at SW-2 is being temporarily suspended.

13. [R645-301-731.800]: Water Rights and Water Replacement. Information on the operational status of COVOL and its use of 5 cfs of water requires updating. (AA)

#### **MRP Insertion Instructions:**

- Sec. 7.31, p. 8, 11/20/12 of this submittal <u>replaces</u>
- Sec. 7.31, p. 8, 09/10/97 of the Division's copy of the MRP

Heat Dryer Pond Dwg. E9-3453, A9-1464, & 712D

Plant Sediment Pond Dwg. 4067-6-21

Slurry Pipeline Sediment Pond Dwg. D5-0163 & 712C

Lower Refuse Dike &

Clearwater Pond Dwg. E9-3460

Upper and North Refuse Dikes Dwg. E9-3427

Clearwater Pond Dwg. 712B

Refuse Basin Dwg. 712A

#### 7.31.800 WATER RIGHTS AND REPLACEMENT

No surface coal mining and reclamation activities will occur within the permit area, however mining of previously deposited coal waste will could occur on the east side of the Price River as part of CWP operations. These CWP operations will use water in amounts up to 5 cfs obtained via existing water rights. Further, because the "mining" is actually the removal of recently placed materials, there will be no potential for subsidence or other interruption of ground water.

14. [R645-301-733.220]: Permanent and Temporary Impoundments. The MRP currently states that no permanent impoundments are proposed. Based on the midterm field visit, a discussion initiated with regard to the Dryer Pond indicating that it could be a candidate for a permanent impoundment given the continuous source of water being fed to it via a culvert. Alluvial water is contained in the impoundment creating a wetland feature of high esthetic value. The Division feels that the quality of the water in the impoundment meets the criteria set forth in 733.220 thru 733.226. The permanent wetland impoundment would have to be added to the reclamation plan and an application for a land-use change, should it be transferred to industrial use. (AA)

#### **MRP Insertion Instructions:**

- Refer to the "Deficiencies and NEICO Comments" pages.
- No change to the MRP on this subject has been prepared for this submittal.

**15.** [R645-301-121.100 & -521.165]: Label the topsoil stockpiles and include them in the legend on Facilities Map E9-3341. (PB)

#### **MRP Insertion Instructions:**

Map E9-3341 of this submittal (dated 10/31/12) replaces
 Map E9-3341 (dated 10/17/06) of the current MRP.

**16.** [R645-301-121.100 & -112.600]: Update Surface ownership map Plate E9-3341 A and Section 112.600 of the MRP. (PB)

#### **MRP Insertion Instructions:**

Map E9-3341 A of this submittal (dated 11/10/12) replaces
 Map E9-3341 A (dated 4/9/92) of the current MRP.

17. [R645-301-820.113]: Currently the Reclamation Agreement (dated 2000) references MRP Chap 1 Ex. A for the bonded area, which is the map included with the COVOL lease, is this reference still accurate? If not, please update the reference to the map illustrating the 392 bonded acres in the 2000 Reclamation Agreement. (Previous reclamation agreements have referred to Dwg. E9-3341 for the bonded/disturbed area. However Map E9-3341 shows a permit boundary that is significantly larger than 392 acres, but does not have a bonded/disturbed area boundary on the map or in the legend. (PB)

#### **MRP Insertion Instructions:**

- This deficiency was addressed in the information described in No. 1 above, so no additional insertions are needed.
- For more information, refer to the "Deficiencies and NEICO Comments" pages.

**18.** [R645-301-233.100]: The 2008 bond describes soil salvage from Areas E, D, H, & I. This will not result in the best available soil in the permit area being utilized. Rather Areas B & C are the most preferable, followed by shallow soils in Area D and G. Compare borrow areas shown on Plates E9-3341 and E9-3511 and make adjustments to Plate E9-3341 to show Borrow Area B and reinstate Borrow Area B on p 4, Sec. 2.41 and make adjustments to the reclamation plan and bond, accordingly. (Area I is not designated or discussed as a borrow area in the MRP.) (PB)

#### **MRP Insertion Instructions:**

- No changes to the borrow areas have been made in the MRP at this time.
- For justifications on the subject, refer to the "Deficiencies and NEICO Comments" pages.

19. [R645-301-541.400]: Site operations have changed since 1998, when Section 2.41 (reclamation plan) was written. Please re-evaluate whether the best-case scenario described in Section 2.41 (removal of coarse refuse by re-mining) is still feasible and whether the potential for using Borrow Area B soils (Dwg E9- 3511) is now possible, and make adjustments accordingly to the Reclamation plan described in Chapters 2 and 5 of the MRP. (PB)

#### **MRP Insertion Instructions:**

Sec. 2.41 p. 1-7, 11/20-12, of this submittal replaces

Sec. 2.41 p. 1-7, (various dates) of the Division's copy of the MRP.

#### 2.41 General Requirements (R645-301-241)

The topsoil borrow plan has been determined by two different methods. A worst-case scenario is has been included to represent the existing conditions in the permit area as of this date and will be used as the basis of bonding calculations. A best-case scenario is also included to account for the approved operation of Covol's wash plant and refuse pond mining plant very real possibility that the fines will eventually be re-mined and removed from the site. This scenario serves as the basis for the release of a part of the permit which formerly contained one of the previous potential topsoil borrow areas. Together, these methods will provide for whichever is the final reclamation plan for the permit area.

This facility was constructed prior to SMRCA and has less than 4,000 cy of topsoil stockpiled for reclamation (see Dwg E9-3341). To meet the worst-case scenario, eovering both the upper and lower refuse ponds 1,034,4001,031,300 cy of soil material is needed. This involves disturbing additional lands within the permit area. Soil investigations reports are included for potential Topsoil Areas H, E, D and G for this scenario. The best-case scenario preserves this undisturbed land, except for a limited area in Area H, by utilizing soil material salvaged during regrading of the Clearwater and Lower Refuse Dikes and requires only 539,300 cy.

All of the undisturbed potential topsoil borrow areas have been sampled extensively. The Clearwater and Lower Refuse Dikes have substantial as-built information in the Hydrology Appendix, 77.216-2(6) - Construction History Attachment; on Drawing E9-1764, (1764A, 1764B), Drawing E9-3460A, and in the Geotechnical Investigation by Rollins, Brown and Gunnell, 1983. Sampling in the identified borrow areas indicates that the soil materials are of adequate quality and quantity for the successful revegetation of all—the entire disturbance in the permit site.

Section 2.22 provides a detailed history of soil sampling in the borrow areas. The results of the field studies and laboratory analyses are also included in this section.

#### Topsoil and Substitute Requirements

The reclamation plan in Sec. 3.41 describes the borrowed topsoil and substitutes required. Appendix J calculates the volumes, depths and acreage required to achieve the plan for this worst-case scenario. Thus, the total amount of topsoil borrow required is 1,034,4001,031,300 cy eubic yards. The best-case scenario, which is intended to minimize total disturbance by maximizing the use of material in the dikes, requires 539,300 cy. To summarize the requirements necessary for borrow soils and substitutes for both scenarios, the reclamation plan requires the following:

#### Main Plant Area

The 44.6 acre area around the main plant area has been heavily used and compacted. This area will receive no additional soil from the topsoil borrow areas since it was disturbed prior to 1977. The small piles of coal wastes will be removed and deposited on the coarse refuse pile.

#### **River Pumphouse**

The river pumphouse area will require 6 inches of borrowed topsoil to cover it. The required volume of borrow topsoil was estimated to be 3,000 cy. The material would be imported from the adjacent Topsoil Borrow Area G in the worst-case-scenario (see Dwg.G9-351 1). In the best-case scenario, the material would be supplied by the Lower Refuse Dike.

#### **Coarse Refuse Pile**

This site would be covered with four feet of coarse-grained Stormitt soil material from Topsoil Borrow Area H for both scenarios. Approximately 43,300 cy of material would be required for a four foot cover. Some grading of the perimeter would be done to consolidate the coarse refuse and reduce the existing area to be covered by 7%.

#### **Upper and Lower Refuse Slurry Ponds**

For the worst-case scenario, the upper (81.2 acres) and lower (71.5 acres) refuse slurry ponds would be covered with four feet of soil materials (985,000 cy). The first two feet would be fine-grained subsoil and substrate from Topsoil Borrow Area E (492,500 cy), followed by two feet of coarse-grained topsoil from Topsoil Borrow Areas D, G and H as well as both of the dikes. A capillary break would be established at the boundary between the lower two feet of fine-grained materials and the upper two feet of coarse-grained topsoil materials. The capillary break would help prevent migration of salts and metals from the lower two feet of cover upwards into the topsoil material.

For the best-case scenario, Covolan operator will have successfully removed all of the coal fines in both the upper and lower refuse ponds. Washed tailings will have been redeposited into the upper pond. The washed tailings have been analyzed in a bench scale test and are reported to be non-toxic (see See. 7.28, pg. 25, 12/05/97). The lower pond will be returned to natural topography. Drawing 9704-T4 illustrates a cross section of the reclamation slope drawn through both ponds. The reference line for this section is shown on Drawing G9-3511. Thus this scenario requires that only the upper pond be covered with four feet of cover. Further, some consolidation of this pond will reduce the area to be covered to 76.4 acres.

Reclamation will begin with the redistribution of the coarse slurry pile to the upper refuse pond. The four foot cover will begin with one foot of impacted soils that are removed from the lower basin after mining. Some testing has been done on samples obtained by drilling in May 1997 which indicate that this soil could well meet the criteria required in Table 2 of the Guidelines. The next one foot will come from the impacted soils immediately under the coarse slurry pile. The final two feet will be available from the regrading of the lower refuse dike and the eClearwater dDike. This material is described elsewhere and it is known to have originally been taken from the immediate area which has since been well characterized. This material is the best available material without disturbing additional lands. However, actual characterization will be performed in the near future by drilling.

#### **Coarse Slurry Pile**

For both scenarios, the material in the eCoarse sSlurry pPile and any natural soil material that was impacted would be relocated onto the uUpper sSlurry pPond prior to the final cover material being placed on it. Therefore, no topsoil borrow is necessary for this area.

#### **Clearwater Dike**

For both scenarios, the dike would be removed and the suitable soil materials (151,000 cy) used in the topsoil redistribution plan for the reclaimed areas (see Drawing E9-1764B). The unsuitable materials (outer layer of dike and pond bottom sediments) would be removed to the upper slurry pond and covered. This material is the best available material without disturbing additional lands. However, actual characterization will be performed in the near future by drilling. The dike materials identified as topsoil borrow would also be tested onsite during excavation. Each material would be tested for texture, pH, SAR prior to distribution. The cleared site would then be reclaimed by using existing native soil materials daylighted with the removal of dikes and pond sediments.

#### **Lower Refuse Dike**

In the worst-case scenario, this dike is regraded to a 5:1 slope which makes 29,700 cy topsoil material available. Two feet of the top and downstream so that this suitable topsoil material could be redistributed as the topsoil cover on the slurry ponds (Drawings E9-1764A and E9-3460A). The suitable materials would originate from the upper portion of the dike that would not have been exposed to contaminants from the slurry pond water either through direct contact or through capillary action. Calculations are attached illustrating the amount of topsoil material to be salvaged. Any unsuitable materials excavated during the borrow operation would be removed to the slurry pond and covered as waste.

In the best-case scenario, this dike is regraded entirely to natural topography which creates 110,400107,400 cy of topsoil material. This would be distributed on the upper pond as part of the final two feet of cover. Any unsuitable materials excavated during the borrow operation would be removed to the upper slurry pond and covered as waste.

This material is the best available material without disturbing additional lands. However, actual characterization will be performed in the future. The dike materials identified as suitable soil borrow materials would be tested on-site during excavation. Each soil material type would be tested for texture, pH, EC, and SAR prior to distribution. The cleared portion of the dike would be reclaimed by using existing suitable native soil materials daylighted with the removal of the borrow.

#### Proposed Topsoil Borrow Areas

Numerous studies have been conducted to identify and characterize topsoil borrow areas and are included in Section 2.22 of the MRP. Currently, eight separate borrow areas have been identified, mapped and soils investigations completed. See Map G9-3511 for locations and boundaries of borrow areas. Below is a description of all the Topsoil Borrow Areas with the volumes of material available and management restrictions:

#### Topsoil Borrow Area A

The soils in this area have been recently identified as "critical farmland" by the NRCS, and thus, are no longer available for borrow.

#### Topsoil Borrow Area B

The land within Area B and most of adjoining Area C is involved in a proposed land sale to develop an industrial area, and thus, is not available for borrow in the future

#### Topsoil Borrow Area C

Most of the land within Area C is involved in the aforementioned land sale and would not be available for borrow. Approximately 13 acres of the eastern portion of Area C is not involved in the land sale and was incorporated into the new Area H.

#### Topsoil Borrow Area D

The soil investigation of six soil pits plus Neico-7 soil pit indicates that 175,429 cubic yards of good topsoil material is available. Most of the borrow would come from Gerst, Juva Variant, and Stormitt soils in the northern portion of the Area. The proposed average topsoil borrow depth is 3.5 feet. This will allow for positive drainage from Area D. See Soil Borrow Investigation - Area D (attached). In the best-case scenario, no disturbance of this area would be necessary.

#### Topsoil Borrow Area E

The soils investigation (see Section 2.22, 7<sup>th</sup> Sample Period) indicates that the surface soils and the deep substrate in A is suitable topsoil material as defined in Table 2. The subsoils and the shallower substrates are not suitable as topsoil but would be suitable as fill, and as fine-grained material would provide a two foot capillary break in the four-foot cover over the slurry ponds. In the best-case scenario, no disturbance of this area would be necessary.

For the worst-case scenario, the surface soils would be removed between a depth of four to nineteen inches and stored on-site. The subsoils and shallow substrates would be borrowed as fill to a depth of about 6.5 feet (492,550 cy). In addition, the slickspots, as unsuitable material (about 87,000 cy), would be removed and distributed on the slurry ponds as waste and would not be counted as part of the fill. Since the slickspots phenomena is concentrated in the surface and subsoils, the actual amount that may need to be excavated may be less. Field testing during excavation would determine the actual amount and depth of material that needs, to be treated as soil waste. The remaining substrate would be suitable material only to facilitate revegetation.

The substrates are very deep, at least 122 inches; thus, the redistribution of the surface soils over the deep substrates (about 44 inches) plus the addition of an average of 12 inches of surface soils would provide a 58 inch deep seedbed of loams and silt loams for revegetation.

Once excavation is complete and the borrow and waste materials removed, the remaining substrate would be ripped to lessen compaction prior to redistribution of the stored surface soil materials. The surface soil materials would be re-distributed evenly over the substrates and an irregular surface left to provide micro-niches for plant growth.

The groundwater table fluctuates between 84 to 180 inches so the depth over the high groundwater level would be at least 6 inches. The only material in contact with the groundwater would be deemed suitable material and be low in salts and metals. The natural occurrence of high salts in the soil profiles indicates that salty groundwater is depositing salts in the subsoils and upper substrates during high water tables. See Soil Borrow Investigation - Area E (attached).

#### Topsoil Borrow Area F

The very shallow soils over the Mancos Shale are unsuitable for borrow.

#### Topsoil Borrow Area G

The estimated volume of Gerst soil materials in this 119 acre area is 12,570 cy based on 17 inches of available topsoil after leaving 18 inches in-situ for revegetation. For the worst-case scenario, the topsoil borrow would be redistributed as the upper two feet of the cover on the slurry ponds (9,7709,550 cy). An estimated 3,000 cy would be distributed to the pumphouse site. The only suitable soils for borrow area the Stormitt soils on crests of the hills and ridges (Soil Report G - Section 2.22). See Soil Borrow Investigation - Area G (attached).

In the best-case scenario, no disturbance of this area would be necessary.

#### Topsoil Borrow Area H

Area H is composed of 13 acres of the old Area C and lands adjoining the Area C on the south and southeast. A recent soils investigation established that 179,332 cy of Stormitt series topsoil material was available on the tops of the knolls and ridges (Section 2.22, 8<sup>th</sup> Sample Period). This coarse-grained topsoil material is suitable for redistribution in the reclaimed areas. Approximately 43,0300 cy of soil material would be used to cover the Ceoarse Rrefuse Ppile on the west side of the river for both scenarios. This quantity of material (and more) is available in the vicinity of test pits C-1, EA-3, EA-4, EA-5. For th worst-case scenario, the remainder (136,032 cy) would be placed on the Slurry Pond(s). See Soil Borrow Investigation - Area H (attached).

#### Clearwater and Lower Refuse Dikes

Through analyses of as-built drawings of the dikes, it was established that Gerst soil material is available in each dike. Since this facility was constructed prior to SMRCA and only very minimal topsoil is stockpiled, it is prudent to use as much of these dikes as possible. It minimizes disturbance to undisturbed lands that otherwise would have to be a source of topsoil borrow.

The Celearwater Delike contains about 166,100 cy of material. The suitable material for redistribution is calculated to be about 91% of this or 151,000 cy (see Dwg. E9-1764B). Regrading this dike to natural topography will be required in both scenarios.

The Lower Refuse Dike contains a minimum of 29,700 cu. This is the amount that will be used in the worst-case scenario. In the best-case scenario, this dike would be regraded to its natural topography and creates 110,400 cy of available topsoil material (see Dwg. E9-1764A).

Actual characterization of both dikes per Table 2 of the DOGM Guidelines will be performed in the near future by drilling. The dike materials identified as suitable soil borrow material would also be tested on-site during excavation. Each soil material type would be tested for texture, pH, EC, and SAR prior to distribution. The cleared portion of the dike would be reclaimed by using existing suitable native soil material daylighted with the removal of the borrow.

Table 2.41-1 is a summary of the reclamation sites and sources of topsoil for the worst-case.

Table 2.41-1: Summary of Reclamation Sites and Topsoil Distribution - Worst Case

Reclamation Site	Topsoil & Cover Required cy	Sources of Borrow & cover by Topsoil Borrow Area cy
River Pumphouse	3,000	Area "G"
Coarse Refuse Pile	43,300	Area "H"
Slurry Ponds	985,000	Area "D" - 175,400 Area "G" - 9,550 Area "E" - 492,500 Area "H" - 136,050 CW Dike - 151,000 LR Dike - 29,700
Coarse Slurry Pile	0 redistributed to slurry pond	0
Totals	1,031,300	1,040,500

Table 2.41-1 is a summary of the reclamation sites and sources of topsoil for the best-case.

Table 2.41-2: Summary of Reclamation Sites and Topsoil Distribution - Worst Case

Reclamation Site	Topsoil & Cover Required cy	Sources of Borrow & cover by Topsoil Borrow Area cy
River Pumphouse	3,000	Lower Refuse Dike 3,000
Coarse Refuse Pile	43,300	Area "H" 43,300
Slurry Ponds	493,000	CW Dike - 151,000 LR Dike - 107,400 Impacted soils: LR basin & Coarse Slurry Pile -246,500
Coarse Slurry Pile	0 redistributed to slurry pond	0
Totals	539,300	551,200

#### Soil Monitoring for Reclamation

The soil profile analyses have been completed for the designated topsoil borrow areas. The specific pedon information will be used to identify horizons that may be unsuitable for substitute topsoil material. As the identified potentially unsuitable horizons are uncovered during the borrow operation, on-site testing will be conducted to determine the material that was unsuitable and may not be available as borrow. The on-site testing includes texture, pH, EC, and SAR. The on-site results will be used to determine whether the material should remain in the pit or be diluted with suitable material for borrow. The unsuitable material remaining in the borrow pit would be buried and covered with 18 inches of suitable material for revegetation.

**20.** [R645-301-121.200 & -121.300]: The Table of Contents lists Tables 2-1 through 2-8, please provide page numbers for these tables in the Table of Contents. (PB)

#### **MRP Insertion Instructions:**

Table of Contents, p. vi, of this submittal <u>replaces</u>
Table of Contents, p. vi, of the Division's copy of the MRP.

#### LIST OF TABLES

TABLE	TITLE	CHAPTER
2-1	Productivity & Wildlife Habitat Potential (p. 32)	2
2-2	Original Soil Samples (p. 35)	2
2-3	Soil Sample Analyses (p. 36)	2
2-4	Soil Sample Analysis (p. 37)	2
2 <b>-</b> 5	Soil Samples (p. 38)	2
2-6	Soil Sample Locations (p. 42)	2
2-7	Soil Laboratory Report (p. 43)	2
2-8	Soil Sample Analyses - South Screening Site (p. 47)	2
2-9	Soil Sample Analyses - South Screening Site (p. 48)	2
2-10	Soil Sample Analyses - South Screening Site (p. 49)	2
2-11	Soil Sample Analyses (p. 53)	2
2-12	Soil Sample Analyses (p. 60)	2
1	Total Cover & Composition of the Atriplex- Hilaria Plant Community	2
2	Mean Percent Cover, Standard Deviation, Sample Size and Relative Frequency by Species of the Atriplex- Hilaria Plant Community	3
3	Woody Plant Species of the Atriplex-Hilaria Community	3
4	Dry Weight Annual Production for the Atriplex-Hilaria Plant Community	3
5	Total Cover and Composition of the Artemisia-Hilaria Plant Community	3
6	Mean Percent Cover, Standard Deviation, Sample Size and Relative Frequency By Species of the Artemisia-Hilaria Plant Community	3
7	Woody Plant Species Density of the Artemisia-Hilaria Plant Community	3
8	Dry Weight Annual Production for th Artemisia-Hilaria Plant Community	3
9	Total Cover and Composition of the Sarcobatus-Suaeda Plant Community	3

**21.** [R645-301-121.200 &-243]: In addition to straw or hay mulch, the application of another form of organic matter was a variable in the 1991 test plot (Appendix A and Sec. 2.33, p. 2). The results of the 1994 test plot evaluation are reported in Section 3.41, but it is not clear what organic amendment was included as a variable. Please clarify. (PB)

#### **MRP Insertion Instructions:**

Sec. 3.41 p. 19, 11/20/12, of this submittal replaces

Sec. 3.41 p. 19, 11/10/94 of the Division's copy of the MRP.

The treatment that exceeded the reference area standard was an irrigated plot with 6" of topsoil and no slurry cover or organic amendment added. To test this trend and the theory that this may only be an anomaly in this plot, one can compare statistically these same treatments individually with all other treatments (Appendix 3.41-A). For example, when irrigation was compared, the trend favors irrigation of over unirrigated plots. Moreover, six (6") inches of topsoil was significantly better than twelve (12") inches in several subplots. The addition of organic amendments\* showed no definite trend when each treatment was compared on an individual basis. Furthermore, the addition of slurry cover seemed to have a negative effect on the plots. More plots did significantly better without the addition of coarse slurry material. This again may be explained by a soil/water relationship as suggested in the CS plot above. These results suggest that the "N" plot in Figure 3-2 may indeed be a reliable set of treatments for reclamation techniques to be used on the slurry pond waste areas.

3.41 19 11/20/12

<sup>\*</sup> In a Midterm Review by DOGM (dated May 30, 2012), a request was made to clarify what organic amendment was incorporated in the revegetation test plots. These plots were constructed in 1984. The initial plans were to utilize sewage sludge that was retrieved from the sewage treatment plant located near the Wellington Prep Plant property. It is believed that this was accomplished, but a review of the files and documents at the offices of *Mt. Nebo Scientific, Inc.* could not positively confirm this conclusion.

**22.** [R645-301-121.200 & -244.200]: Section 3.41 p. 4a varies from the remainder of Section 3.41 and Section 2.41 with regard to the approach to seeding, surface roughening and mulch incorporation. Is ripping followed by green hay incorporation with drill seeding specific to a location within the permit area? If so, please specify on page 4a the area to receive the treatments described on page 4a. (PB)

#### **MRP Insertion Instructions:**

Sec. 3.41 p. 4a, 11/20/12, of this submittal <u>replaces</u>

Sec. 3.41 p. 4a, 09/10/97 of the Division's copy of the MRP.

#### 3.41 REVEGETATION REQUIREMENTS (R645-301-341)

#### Description of Disturbed Areas

Approximately 392 (only 0.36 acres of flotation cell site + tank site) acres have been identified as disturbed at the Wellington site. This area is where COVOL, TECHMAT and General Resources operated a fines wash plant. This site has been reclaimed. For more information about the reclamation refer to Section 5.15).

Revegetation Methods for Each Disturbed Area

#### Additional Surface Facilities Area (Modular Wash Plant Area)

Following removal of the flotation cells and the slurry tank revegetation techniques will be implemented.

#### Soil Ripping

The access road to the flotation cells will be ripped to a minimum depth of one foot with rippers spaced a maximum of two feet apart. The cell and tank sites will have the construction materials removed but the sites will not be ripped due to the possibility of bringing rnancos shale material to the surface.

#### **Topsoiling**

One foot of topsoil from the stockpiles will be applied to the flotation cells and tank sites but not to the access road, which has native soils in place.

#### Gouging

Gouging will be implemented in the topsoil material at the cell and tank sites but not in the access road because the ripping of the roadbed will leave the surface roughened.

The steep slopes below the cell site will be ripped on the contour to provide furrows to increase moisture retention in the seedbed to facilitate seed germination and seedling growth. The rippers will be spaced four feet apart and ripped to a depth of 18 inches.

#### Fertilization

All of the area to be seeded will be fertilized with 80 lbs/acre of N and 80-160lbs./acre of P. The exact amounts will be determined by final topsoil sampling and analyses.

#### Mulching

The area to be seeded will be mulched at the rate of two tons per acre of green alfalfa hay. The hay will be chopped and blown on to be incorporated into the seedbed by the subsequent action of the seed drill.

#### Seeding

The topsoiled an ripped areas will be drilled to place the seed at a 1/4-1/2" depth in the prepared seedbed. Seed mixture A for Atriplex-Hilaria plant community will be used for this area.

**23**. No deficiencies were issued by Ingrid Campbell; however, the Division would like to remind the Permittee that they have committed to remove Class C noxious weed, tamarisk, in riparian areas and replanting with willow and cottonwood cuttings to enhance wildlife habitat (Mining and Reclamation Plan Volume I-A, Section 3.42).

#### **MRP Insertion Instructions:**

- Refer to the "Deficiencies and NEICO Comments" pages.
- No change to the MRP on this subject has been prepared for this submittal.

**24.** [R645-301-112.330]: The information in the current MRP presented below does not match the information found in the OSM/AVS database. The Operator should submit either updated pages for the MRP to reflect the correct information, or the Operator should provide a Secretary's Certificate or End Dates so that the AVS can update its records. (AN)

#### **NEICO**

- 1. The following individuals have a different Begin Date in the MRP as compared to the date listed in the AVS database.
  - a. Michael W. Yackira, President & Treasurer (AVS 6/01/04 vs. MRP Aug 2004)
  - b. Paul J. Kaleta, Secretary (AVS 2/01/06 vs. MRP Apr 2006)
  - c. Walter M. Higgins, Director (AVS 6/01/04 vs. MRP Aug 2004)

This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct the AVS.

#### Nevada Power Company

- 1. The AVS shows Walter M. Higgins, Chairman and CEO, with a Begin Date of 10/01/04. The MRP shows a Begin Date of Aug 2000. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 2. The AVS shows Krestine M. Corbin, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of July 1999. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the ,4 VS.
- 3. The AVS shows T.J. Day, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of July 1999. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 4. The AVS shows James R. Donnelley, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of July 1999. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- S. The AVS shows Walter M. Higgins, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of August 2000. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 6. The AVS shows Philip G. Satre, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of January 2005. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 7. The following individuals are in the AVS database as an Officer or Director, but they are not listed in the MRP:
  - a. David Barney, Vice President, 10/01/93

- b. Charles Lenzie, COB and CEO, 10/01/93
- c. Richard Hinkley, Director, 5/01/91
- d. Richard Hinkley, Vice President, 10/01/93
- e. Cynthia Gilliam, Vice President, 10/01/93
- f. Steven Rigazio, Vice President, 10101/93.
- g, Gloria Weddle, Vice President, 10/01/93
- h. Fred Gibson, Jr., Director, 2/01/78
- i. John Goolsby, Director, 1/01/91 C. Ryan, Director, 9/01/78
- k. Frank Scott, Director, 5/l/72
- 1. Arthur Smith, Director, 1/01/59
- m. J. Tiberti, Director, 11/01/63
- n. Walter Higgins, President, 10/01/04
- o. Earnest East, General Counselor/Secretary/SV'P, 10/01/04

These discrepancies should be addressed by either correcting the MRP or submitting End Dates or a Secretary's Certificate to update the AVS database.

#### Sierra Pacific Resources

- I The AVS shows Walter M. Higgins, President, with a Begin Date of 10/01/04. The MRP shows a Begin Date of Aug 2000. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 2. The AVS shows Walter M. Higgins, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of August 2000. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 3 The AVS shows Philip G. Satre, Director, with a Begin Date of 2/20/05. The MRP shows a Begin Date of January 2005. This discrepancy should be addressed by either correcting the MRP or providing a Secretary's Certificate to correct this information in the AVS.
- 4. The following individuals are in the AVS database as an Officer or Director, but they are not listed in the MRP:
  - a. David Barneby, Vice President, 7/29/99
  - b. William Peterson, Sr. Vice President, 7/29/99
  - c. Steven Rigazio, President, 5131100
  - d. Gloria Weddle, Vice President, 7/29/99
  - e. Fred Gibson, Jr., Member, 7/29/99
  - f. Mark Ruelle, CFO/SVP/Treasure, 7/29/99
  - g. Matt Davis, Vice President, 7/29/99
  - h. Steven Oldham, Vice President, 6/20/00
  - i. Douglas Ponn, Vice President, 7/29/99
  - i. Mary Jane Reed, Vice President, 7/29/99
  - k. Mary Simmons, Controller, 7/29/99
  - l. Edward Bliss, Member, 7/29/99
  - m. James Murphy, Member, 7/29/99
  - n. Earnest East, General Counselor/Secretery/SVP, 10/01/04

These discrepancies should be addressed by either correcting the MRP or submitting End Dates or a Secretary's Certificate to update the AVS database.

#### **MRP Insertion Instructions:**

• This deficiency was addressed in the information described in **No. 1** above, so no additional insertions are needed.

25. [R645-301-830.140]: The reclamation cost estimate which is approved and incorporated into the current Wellington Prep Plant mining and reclamation plan has not been updated to current unit costs. Current unit costs are used to calculate the direct costs of reclamation including demolition, backfilling and grading, and revegetation. Also, there has been on-site demolition that is not reflected in the MRP. Updates should be provided using the 2012 data from R.S. Means Heavy Construction Cost data manual and the Caterpillar Handbook or other appropriate resources. Also, bond summary sheets are not updated to current escalation factor estimates. The Permittee must provide updated information in terms of detailed estimated cost, with supporting calculations for the estimates, submitted by the permit applicant. This includes updated unit costs (to be used to update bond calculation spreadsheets) and updated escalation factors (used the Division's approved 1.2% and 5 year escalation). (JO)

#### **MRP Insertion Instructions:**

Cost of Reclamation, Appendix J, January 31, 2013, of this submittal replaces Cost of Reclamation, Appendix J, February 27, 2008 of the Division's MRP

### APPENDIX J

# COST OF RECLAMATION January 31, 2013



# SUMMARY OF BOND CALCULATIONS (1) FOR THE WELLINGTON PREPARATION PLANT (C/007/012)

(1) For detailed cost analysis and other information including demolition, earthmoving, volumes, equipment and revegetation, refer to the attached spreadsheets.

DIRECT COSTS  Demolition and Removal  Backfilling and Grading  Revegetation  Subtotal Direct Costs	\$240,665 \$2,074,188 \$762,892 <b>\$3,077,745</b>
INDIRECT COSTS  Mobilization/De-mobilization (10.0%) Contingency (5.0%) Engineering Redesign (2.5%) Main Office Expense (6.8%) Project Management Fee (2.5%) Subtotal Indirect Costs (26.8%)	\$307,775 \$153,887 \$76,944 \$209,287 \$76,944 <b>\$824,837</b>
TOTAL COSTS	\$3,902,582
Escalation factor (0.012) Number of years (5.0) Escalation	\$239,842
Reclamation Cost Escalated	\$4,142,424
Dollar Year: 2013  BOND AMOUNT (rounded to nearest \$1,000)	\$4,142,000

## DEMOLITION



Revised January 2013

Wellington Prep Plant C/007/012

Wellington Prep Plant C/007/012

Refuse Pipeline 01 Students Populine Ocast Structure's Pomolition Cost Structure's Vol. Demoished Rubbie's Weight (exclude stee) Truck's Capacity Haudag Transportation Cost Non Steel Truck Transportation Cost Non Steel		Number				<b>.</b>							Factor			
Structure's Vol. Demolished Aubbie's Weight (exclude steel) Truck's Capacity Truck's Capacity Transportation Cost Non Steel Truck Transportation Cost Non Steel Drive Transportation Cost Non Steel Transportation Cost Non Steel Transportation Cost Non Steel Transportation Transportation	Steel Bld. Large	02 41 16.13 0020	0.35 /CF					64230	30			CF			64230 CF	22481
Authobie's Weight (exclude steel) Truck's Capacity Haulage Transportation Cost Non Steel Truck Transportation Cost Non Steel Drive Transportation Cost Non Steel Drive Transportation Cost Non Steel								8	833			C√	0.35		833 CY	
Truck's Capacity Iruck's Capacity Iruck Iransportation Cost Non Steel Truck Iransportation Cost Non Steel Drive Iransportation Steel Drive Spaces Cost Non Steel Spaces Word Non Steel Spaces Word Non Steel							+				+	+	1			
Haulage Transportation Cost Non Steel Truck Transportation Cost Non Steel Drive Disposal Cost Non Steel Disposal Cost Non Steel				1		+	-				+		1		1	
Transportation Cost non Steel Truck Transportation Cost Non Steel Drive Disposal Cost Non Steel				+	+		+	+	$\downarrow$		t	$\dagger$	+	_		
Transportation Cost Noti Steel Drive Disposal Cost Non Steel				<u> </u>	+					1	$\dagger$	+	<u> </u>	-	1	
Stool's Maight				<u> </u>		+			+		+	+	<u> </u>		I	
				<u> </u>				-	-				l			
Truck's Canacity				<u> </u>				-	-	ļ	t		<u> </u>	-		
Hacks capacity Hailage													l			
Transportation Cost Steel Truck																
Transportation Cost Steel Truck Drive																
Disposal Cost Steel																
Subtotal		Charles appropriate	18 S. Y. S. V. W. T. C.	The second second	Control of the second				- A		Standard St	State Williams	8.00	0.00		22481
Equipment 's Disposal Cost																
Dismantling Cost																
Equipment 's Vol. Demolished																
Loading Costs																
Transport Costs									+							
Disposal Costs							+				1		1			
Subtotal				The same				Con Control Control	AND STATE OF	- 10 Car	C. 1894 C. 1			100	0	
				<u> </u>	+		1	+	+				<u> </u>		1	
		44 46 40 0000	300	+	0000				+	1	t	4	<u> </u>	GBC	EROO E	2380
	steel Bid. Large	0.0	0.00	+	000		+	-			t	1	Ī	8	1	4
Pipes Vol. Demolished				1	+		+	-	-	1	t		T			
Loading Cost					+	1	+	+	+	1	$\dagger$		I	+	_	
Fransportation Cost				<u> </u>				<u> </u>	+		t		<u> </u>	-	L	
Uisposal Costs																2380
oublotal									1							
Foundation's Demolition				<u> </u>			-	-	-		t		<u> </u>			
	concrete demo/ load/ dump	03 05 05.10 0060	13.1 /CY						62			C			62 CY	812
I. Demolished													1	1.3	81 CY	
u.	ront end loader 3 CY		/CY												81 CY	
Transportation Cost 12 C	2 CY (16 Ton) Dump Truck 1/2 mi. md. trip		/CY								1			_	31 CY	
Costs	On site disposal	02 41 16.17 4200	10.2 /C)											~	81 CY	826
Subtotal															0.000	1638
Concrete Demolition							-									
Demolition Cost																
Concrete's Vol. Demolished																
Loading Cost																
Transportation Cost										1	1					
Disposal Costs					+				-		1	+				
Subtotal		Manufacture Section	The state of the s			Charles Charles	No. of Concession, Name of Street, or other Persons, Name of Street, or ot	STATE OF STA	The same		The second			September 1		State of a Action
									-				I	-		00400

Page 2 of 13 RefusePipeline01



Part	Description	Materials	Means Reference Number	Cost	Tien On Tien	Length width	100	Diameter	8		weight Density	r)	<u>ш</u>	Factor	, and the same of	
Devication of sear that target says to the search of the s	Pumphouse 02															-
10   10   10   10   10   10   10   10	Structure's Demolition Cost	Steel Bld. Large	02 41 16.13 0020		CF					0			CF		0 CF	
Page	Structure's Vol. Demolished									0			CY	0.35	0 CY	
Control Start True	Rubble's Weight (exclude steel)															
Control Cont	Truck's Capacity															
Control test State   Table	Haulage															
A	Transportation Cost Non Steel Truck															+
Second	Transportation Cost Non Steel Drive															
Pacific   Paci	Disposal Cost Non Steel															
Page	Steel's Weight															
The control of the	Truck's Capacity															
A Comparison of the comparis	Haulage															
Steat Truck Diver   Steat Truck Diver Diversify   Steat Truck Diversify   Steat	Transportation Cost Steel Truck															
A Controlle demoi load damp   Did 50 to 10 0000   13 1 CV   Did 50 to 10 0000   Did	Transportation Cost Steel Truck Drive															
Demoksheed  Concrete demon load dump  1. Conc	Disposal Cost Steel															
Demoished Coast Demoished Courted clared based Cutting Courted clared based 2 CV St. Courted clared based 3 CV St. Courted 5 CV St. Courte	Subtotal		The state of the s	A CONTRACTOR OF				THE PERSON NAMED IN			Street, Section 1					
Demoished    Concrete demoi basil dump   Concrete demoi ba																
Demoished Teach and found based sturp (2007 to 10.000) 13.1 CV (2007 to	Equipment 's Disposal Cost															
Cooking State   Cooking Stat	Dismantling Cost															
Coasis         Coasis<	Equipment 's Vol. Demolished															
Cooking   Cook	Loading Costs															
Costs   Cost	Transport Costs															
Concrete Genovi load' dump   03 05 05 10 0060   13 1 kV   13 0 0   13 0 0 0   13 1 kV   13 0 0   13 0 0 0 0   13 1 kV   13 0 0   13 0 0 0   13 1 kV   13 0 0   13 0	Disposal Costs															
Demoiltan   Concrete demoi load dump   03 06 05 10 0060   13 1 CY   13   CY   CALL Demoished   Concrete demoi load dump   Concrete demoi load dump   Concrete demoi load dump   CONCRETE	Subtotal			THE PROPERTY OF THE		Total Section	A COLUMN TO SERVICE STATE OF THE SERVICE STATE OF T								1000000	
Concrete demoi load dump   Concrete demoi load																-
Comparing the department of the control to a control to	Floor's Demolition			П												
13 Content   Front end loader 3 CV   10 CV	Demolition Cost	Concrete demo/ load/ dump	03 05 05.10 0060	τ.	CY					0			CY		0 CY	-
	Floor's Vol. Demolished													1.3	0 CY	+
12 C/ (16 Ton) Dump Truck 1/2 mit rind, tip   10 C/Y   10 Costs   11 C/Y   10 Costs   12 C/Y (16 Ton) Dump Truck 1/2 mit rind, tip   10 C/Y   13 C/Y   14 C/Y   14 C/Y   15	Loading Cost	. 1			C										0 CY	1
Section   Consisted deposal   102   CV   131   CV   1	Transportation Cost	Dump	- 1		CY										0 CY	-
Interest	Disposal Costs	On site disposal	02 41 16.17 4200		CY										0 CY	
A control of the co	Subtotal			State of the state		Section of the second	St. Actal			A						
Item Cost					T							1	1			+
India   Contracts cannot be a contract contract cannot be a contract cannot c	roundation's Demoitton		0300 04 30 30 50	4.04	2					c			2		>	
Construction   Front and loader 3 CV   CV   CV   CV   CV   CV   CV   CV	Demolitical Cost	Concrete demon load, dump	03 03 03 10 0000	2	5								5	13	200	
12 CY   12 CY   12 CY   12 CY   12 CY   12 CY   13 CY   13 CY   13 CY   14 CY   15 C	Foundation's vol. Demonshed	October of production of the contract of the c			2								Ī	2	> >	+
Sear Coasts         On site disposal         10.2 (CV         10.2 (CV           Sear Coasts         On site disposal         10.2 (LV         10.2 (CV           Sear Coast         Sear Coasts         Sear Coasts         Sear Coasts	Transportation Cost	12 CV (16 Ton) Dump Truck 1/2 mi rad	in in		2										> 0	+
Italy	Disposal Costs	On site disposal			2							-	ļ		) OC	-
Concrete Demolition Demolition Cost Transford Cost	Subtotal															
Concrete Demoilion   Concrete Demoilion   Concrete Demoilion   Concrete Demoilion   Concrete S viol. Certain Contracte S viol. Certain																
Demolition Cost         Colored Ex Vol. Demolished           L Calcurate Ex Vol. Demolished         Express of Express o	Concrete Demolition															
Concrete's Vol. Demoished         Concrete's Vol. Demoished           Transportation Cost         Concrete's Vol. Demoished           Disposal Costs         Concrete's Vol. Demoished	Demolition Cost															
Locating Document         6           Disposal Costs         6	Concrete's Vol. Demolished															
Transportation Cost	Loading Cost															
Disposal Costs   Disp	Transportation Cost															
Subforal	Disposal Costs															-
	Subtotal									Action of the second	CHARLES AND	A150 MISS IN	1917	Section of the second		Total Control
																1

Page 3 of 13

Powerline East 03 Structure's Demolition Cost Structure's Vol. Demolished Structure's Weight (axclude steel) Track's Canacity		Reference	Cost			D						Factor		5	1600
Structure's Demolition Cost Structure's Vol. Demolished Rubbles Weight (exclude steel) Trick's Canadia															
Structure's Vol. Demolished Rubble's Weight (exclude steel) Trick's Canadity	Powerpole	02 41 13.80 0100	192 EA								25 EA			25 EA	4800
Rubble's Weight (exclude steel)								0			0	CY	0.35	CY	
Aliceia Sanata															
Track Supray				1	1		+					1			
Transportation Cost Non Steel Truck			+	<u> </u>		-				<u> </u>		<u> </u>			
Transportation Cost Non Steel Drive															
Disposal Cost Non Steel															
Steel's Weight															
Truck's Capacity															
Haulage															
Transportation Cost Steel Truck															
Transportation Cost Steel Truck Drive															
Disposal Cost Steel															
Subtotal				Control (Section )	Marie Statement of the					A Charles		The second second	A COLUMN TO SERVICE AND ADDRESS OF THE PERSON ADDRESS OF THE PERSON AND ADDRESS OF THE PERSON AN		4800
Conductort 's Disposal Cost															
Dismantling Cost															
Conductor 's Vol. Demolished															
Loading Costs															
Transport Costs															
Disposal Costs															
Subtotal											The second second				0
				1											
Concrete Demolition				1	1		1			1	1	1	+		
Demolition Cost				1											
Concrete's Vol. Demolished				1											
Loading Cost									1			1			
Transportation Cost				T								1			
Disposal Costs									The state of the s						
Subtotal			Carlo Section Section (Section )		No. of the last of		No. of Contract of		NAME OF STREET	TAN AND PROPERTY.					
Concrete Demolition				T								1			
Demolition Cost				<u> </u>										ļ	
Concrete's Vol. Demolished															
Loading Cost															
Transportation Cost															
Disposal Costs															
Subtotal	Printer and a significant for employment and the	And the control of th	The state of the state of the	The second									Second Second Second	A CONTRACTOR	- Company
Concrete Demolition															
Demolition Cost															
Concrete's Vol. Demolished															
Loading Cost												1			
Transportation Cost			+									1			
Disposal Costs															
Subtotal			No. of Contract of	Constant Bally of	STATE OF THE PARTY	7425		100 Company	POR THE PROPERTY OF			The second			
															4000

Page 4 of 13

ClearWaterDike04 Page 5 of 13

Jump 02 41 16.17 4200 10.2  Jump 03.05 05.10 0060 13.1  Truck 1/2 mi. md Urip 02 41 16.17 4200 10.2	Audobies weight (exclude steer) Haulage Transportation Cost Non Steel Truck Haulage Transportation Cost Non Steel Truck Transportation Cost Non Steel Steel Weight Transportation Cost Steel Truck Drive Steels Weight Transportation Cost Steel Truck Drive Subtoal Equipment's Disposal Cost Disposal Cost Steel Subtoal Disposal Cost Steel Subtoal Transport Costs Transport Costs Transport Costs Disposal Cost Transport Costs Transport Costs Disposal Cost Transport Costs Disposal Cost Transport Costs Transport		02.41 16.13 0020 03.05 05.10 0060	0.36 A	ICY COY COY	6	70 70 0	00 00 00 00 00 00 00 00 00 00 00 00 00	4063		<u> </u>	0.35	118		110250
Coact dump   03 05 10 0060   131   CV   13   CV   13   CV   13   29   CV   13   29   CV   14   29   CV   15   CV		12 CV (1b Ion) Dump I ruck 1/2 mi. ma. trp On site disposal	02 41 16.17 420	2	5 6								152	CY	1550 3083
Dump Truck 1/2 mi, md trip    Columb Truck 1/2 mi, md trip   C			03 05 05.10 00		λ λ				22		δ	+		55	288
		Dump	02 41 16.17 420		<u>۲</u>								29	CY	296
		On site disposal	$\approx$		C.								32	5	584
							H			$\parallel$					

## This is the old facilities area.

Page 6 of 13



	Cesciption	Materials	Means	1115	=======================================	Leigin				-									
Since But Large   Start But			Reference Number	Cost												Factor			
Since Bill Larger   1241 16 17 2000   0.35   CF   CF   CF   CF   CF   CF   CF   C	Column Flotation Cells 06																	-	L
Track   Trac	Structure's Demolition Cost	Steel Bld. Large	02 41 16.13 0020	0.35	/CF			42							4 FT			0 FT	
Concerne General Conc	Structure's Vol. Demolished										109				0		0.35	109 CY	
A	Rubble's Weight (exclude steel)																		
Thick Drive  A Concrete control county case County  Concrete control county  Contr	Truck's Capacity									-									
No. 10   N	Haulage									-	-	-							
A Control Co	Transportation Cost Non Steel Truck																		
A Concession Concessio	Transportation Cost Non Steel Drive														-				
A fine to the control lead army	Disposal Cost Non Steel																		
A Drive  A Drive  Concrete carrol back 2 ctrp  Concrete carrol back 2 ctrp  Concrete carrol back 2 ctrp  Concrete carrol back 12 mm and 100  Concrete carrol back 2 ctrp  Concrete carrol back 12 mm and 100  Concrete carrol back 2 ctrp  Concrete carrol back 12 mm and 100  Concrete carrol back 2 ctrp  Concrete carrol back 12 ctrp  Concrete carrol back 2 ctrp  Concrete carrol back 2 ctrp  Concrete carrol back 2 ctrp  Concrete carrol back 3 ctrp  Concrete carrol back 2 ctrp  Concrete carrol back 3 ctrp  Concrete carrol back 1 ctrp  Concrete carrol back 3 ctrp  Concrete carrol back 1 ctrp  Concrete carrol back 3 ctrp  Concr	Steel's Weight																		
K   From the control to lead of sump   Con	Truck's Capacity																		
A Divide	Haulage																		
Concrete central coach disposal and state of coach disposal a	Transportation Cost Steel Truck																		
Converse demoi load dump   03 05 05 10 0090   13 1 10 Y   40   40   0.5	Transportation Cost Steel Truck Drive																		
Concrete demot load: Jump	Disposal Cost Steel																	109 CY	
Concrete demoi based cump   So to 5 to 10 0000   13 1 CV   40   40   0.5     15 1 CV   40   40   40   40   40   40   40   4	Subtotal		The state of the s		100000000000000000000000000000000000000		N. STATISTICS	The State of	State of the state of		The section of	S 84	The second	The second	150	Secure Actions	A	Service of the service of	
Concrete demoi loadi dump   03 05 05 10 0080   13 1/CY   40   40   0.5																			
Concrete demot loads dump  Concrete demot loads dump  Event and loads disposal  Concrete demot loads dump  Concrete demot loads d	Equipment 's Disposal Cost														-				
Concrete damo! load! dump   03 05 05 10 0060   131   CV   40   40   0.5	Dismantling Cost																		
Converted carrow loads' dump   C3 05 05 10 0060   131   CY   40   40   0.5	Equipment's Vol. Demolished														-				
Concrete demoi loadi dump	Loading Costs																		
Concrete demo' lead' dump   03 05 05 10 0060   13 1   CV   40   40   0.6     FT   13   0.0	Transport Costs										-								
Concrete demot load/ dump	Disposal Costs																		
Concrete damo/ load/dump   03 05 05 10 0060   13 1 kV   40   0.5	Subtotal				- T. C.		70.00			14.6							STORY OF THE		
Concrete demol load' dump   03 05 05 10 0060   13 1 KY   40   40   0.5																			
Concrete demoi loadi dump   03 05 05 10 0060   13 1   CY   CY   CY   CY   CY   CY   CY	Floor's Demolition																		
Front end leader 3 CY   12 CY (16 Ton) Dump Truck 1/2 mt, rnd trip   102 d 1 t6 17 4200   10.2 f CY   12 CY (16 Ton) Dump Truck 1/2 mt, rnd trip   10.2 f 1.6 17 4200   13.1 f CY   12 CY (16 Ton) Dump Truck 1/2 mt, rnd trip   12 CY (16 Ton) Dump Truck 1/2 mt, rnd trip   10.2 f 1 t6.17 4200   10.2 f CY   12 CY (16 Ton) Dump Truck 1/2 mt, rnd trip   10.2 f 1 t6.17 4200   10.2 f CY   10.2 f 1 t6.17 4200   10.2 f 1 t6	Demolition Cost	Concrete demo/ load/ dump	03 05 05.10 0060	13.7	/C\	40	40	0.5						+	Œ			OCY	
12 CV (16 Ton) Dump Truck 1/2 m), rnd trip   CV   10.2 (CV   10.	Floor's Vol. Demolished				200											1	1.3	CY	
12 CT 10 10th Dump Truck 12 mil 10 20	Loading Cost	_ I'.			/C.					$\dagger$	$\dagger$	$\dagger$	+	+	+	1	+	+	
Concrete demot load dump	I ransportation Cost	dwnn .	- 14		ڕؙۮ					+	$\dagger$	+	+		+	1	1	20	
Concrete demoi load dump   03 05 05 10 0060   13 1 CV   13   CV   13   CV   13   CV   15   CV	Ulsposal Costs	On site disposal	02 41 10.17 4200	70	2													5	
Concrete temol load dump   03.05.05.10.0060   13.1 CY   13.0 CY   14.2 CY (16 Tan) Dump Truck 1/2 mir d trip   CCV   10.2 CY	Subtotal		The transfer of the second	The state of the s	See Management		No. of the last of		Contract of the last	The second second	0	The state of the s	STATE OF STREET			September 1 States		2	
Concrete demo/ load dump   03 05 05 10 0060   13 1 (CV   1.3   0.0	Foundation's Demolition									+				+	+	<u> </u>	+	+	
Front and loader 3 CV	Demolition Cost	Concrete demo/ load/ dump	03 05 05 10 0060	13.1	/C/					$\dagger$	o	+	-		Ć			>0	
Front and loader 3 CV   Front and the part of the pa	Foundation's Vol. Demolished														-		1.3	C C	L
12 CV (16 Ton) Dump Truck 1/2 mi. md trip On site disposal	Loading Cost	Front end loader 3 CY			/CY														
On site disposal 02 41 16 17 4200 10 2 /CY 00 site disposal 02 41 16 17 4200 10 2 /CY 00 00 00 00 00 00 00 00 00 00 00 00 00	Transportation Cost		0		/CY														
Subtotal         Concrete Demoilton           Concrete Demoilton         Concrete Demoilton           Concrete Demoilton         Concrete Demoilton           Concrete Demoilton Cost         Concrete Demoilton           Leafordisch Cost         Concrete Demoilton           Disposal Costs         Concrete Cost           Subtoral         Concrete Cost           Subtoral         Concrete Cost           Subtoral         Concrete Cost	Disposal Costs	On site disposal	02 41 16.17 4200	10.2	/CY													OCY	
Concrete Demolition         Concrete Demolition           Demolition Cost         Concrete S vol. Demolished           Concrete S vol. Demolished         Fransportation           Transportation Cost         Disposal Costs           Subtoral         Subtoral	Subtotal			100000000000000000000000000000000000000			74.70												
Concrete Damilton         Concrete Sample         6 <t< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></t<>																			
Denotation of the control of the con	Concrete Demolition																		
Concreted SVI). Demolished Loading SVI. Demolished Loading SVII. Demoli	Demolition Cost																		
Transprint Cost	Concrete's Vol. Demolished																		
Transportation Cost         Obsposal Costs           Disposal Costs         Subtotal	Loading Cost																		
Disposal Costs Subtotal	Transportation Cost																		
Subotal	Disposal Costs																		
	Subtotal	The state of the s		The Age of the Party	The state of the s	The second		The second second	The second second	Service of the servic		The second second	1						
														_	_				

Covol Site has been dismantled, salvaged and reclaimed.

ColumnFlotationCells06 Page 7 of 13



Number   Conveyer Peter   Conveyer Pet		Materials	Reference	Cost			D.				Sie la	2		Fa	Factor	Adding.	i i
State   Stat	Continue Bolls 07		Number														
A control seed   Co	Structure's Demolition Cost	Steel Bld. Large	02 41 16.13 0020	0.35	J.O.	800	15	22						FT		O U	-
Controller Steel   Controller Steel   Controller Steel   Controller Steel   Controller Steel   Controller Steel Controller	Structure's Vol. Demolished									259				CY	0.35	OCY	
as Seel Truck as Seel Truck as Seel Truck as Seel Truck bendished  Foot and capesal  bendished  Foot and capesal  bendished  Core and capesal  bendished  foot and capesal  bendished  bendished  foot and capesal  foot and capesal  bendished  foot and capesal	Rubble's Weight (exclude steel)																
ost Non Steel Truck ost Steel	Truck's Capacity																
and Seed Truck  The Seed Truck  The Seed Truck Drive  The Seed Tru	Haulage																
Steel Truck	Transportation Cost Non Steel Truck																
Steel Truck	Transportation Cost Non Steel Drive																
est Steel Truck           ost Steel Truck Drive           posal Cost           posal Cost           Demolished         Font end basien 3 CV           of steel of Truck	Disposal Cost Non Steel																
act Steel Truck Drive         Seel Truck Drive           best Steel Truck Drive         Seel Truck Drive           act Steel Truck Drive         Seel Steel Steel           benoished         Form and Loader 3 CY           Demoished         Front and Loader 3 CY           fron         CY           ost         CY           on site disposal         D2 41 16 17 4200           lion         Seel	Steel's Weight																
Steel Track Dive   Steel Track	Fruck's Capacity																
State   Truck Drive   State   State   Truck Drive   State   St	Haulage																
Demolished	Transportation Cost Steel Truck																
Demolished   Dem	Transportation Cost Steel Truck Drive																
Demolished   Dem	Disposal Cost Steel															0 CY	
Demoished   Courtie demoi load: dump   Courtie	Subtotal				Contraction of the last		The second second		Section of the		The state of the s	Contract Con					
Demoished   Demo																	
Demolished	Equipment 's Disposal Cost																
Demoished   Demo	Dismantling Cost																
Demolished   Concrete demol load's dump   Cos 05.10 0060   13.1 / CY   CY	Equipment 's Vol. Demolished																
Total Concrete demo' load' dump   03 05 05 10 0060   13.1 /CY	oading Costs																
Concrete demoi load' dump   CO 65 05 10 0060   13.1 (CY	Transport Costs																
Tourished For and damp 03 05 05 10 0060 13.1 fcY  Demoished For and leader 3 CY 12 CY 107 fc Ton) Dump Track 1/2 mi md trp  Demoished  Total disposal  Total d	Disposal Costs																L
Concrete demoi load' dump   Concrete demoi load dump   Concrete demoi load dump   Concrete demoi load dump   Concrete demoi load	Subtotal				Marine Services												
Concrete demoi load' dump   Cont end loader 3 CV   CV   CV   CV   CV   CV   CV   CV																	
Concrete demoi load/ dump   13 16	oundation's Demolition																
Front and loader 3 CY   Front and loader 3 CY   12 CY (16 Ton) Dump Track 1/2 mi. md. trp   12 CY (16 Ton) Dump Track 1/2 mi. md. trp   102 dire disposal   102 mite disposal   102 mite disposal   103 mite disposal   104 mile disposal   105 mite	lemolition Cost	Concrete demo/ load/ dump		13.1	/CY					37				CY		0 CY	
Front end basels 3 CY   Front end basels 3 CY   12 CY (16 Ton) Dump Truck 1/2 m, rnd. trip   02 41 16 17 4200   10.2	oundation's Vol. Demolished														1.3	O CY	
0 ost 12 CY (16 Ton) Dump Truck 1/2 mi, md, trip On site disposal  ton Demolished  ost from One site disposal  ost ost ost ost ost	oading Cost	Front end loader 3 CY			/CY												
ton ton emolished cst ton ost ost ost ost	ransportation Cost	12 CY (16 Ton) Dump Truck 1/2 mi. rnd.			/CY												
tion Demoished Ost Iton Demoished Ost	Disposal Costs	On site disposal		10.2	/CY											O CY	
Demoished Sost Itian Demoished Demoished Demoished	Subtotal				2003							THE PERSON NAMED IN	300			200	
Demoished Sost Ition Demoished Sost												-					1
Demoished Jost Inton Demoished Oost	Soncrete Demolition																+
Demoished Sost Ition Demoished Sost	Demolition Cost																
Demoished  Demoished	Soncrete's Vol. Demolished																
Oest lifton Demoished Oest l	oading Cost																
Itton Demoished Sost	Fransportation Cost																_
inton Demoished Jost	Disposal Costs																
ition Demoished Sost	Subtotal		State of the state								The second second	- The state of the					
Demolished Sost					Ť	+	+	+		+	+	+	_	†	+	+	+
Demolished Cost	Concrete Demolition				Ť	1				+				1	+	+	+
Demoished Sost	Demolition Cost																
Sost	Concrete's Vol. Demolished				1											+	
Cost	oading Cost																
	Fransportation Cost																-
	Disposal Costs																-
	Subtotal	A CONTRACTOR OF THE PROPERTY O	Mary Company of the Party of th			Section of the second						The second second			STORY OF STREET	Townson of the last	200
Total	eic																

covol Site has been dismantled, salvaged and reclaimed.

ConveyorBelts07 Page 8 of 13

Covol Site has been dismantled, salvaged and reclaimed.

Description	Materials	Reference	Cost			,								Factor		
Diesel 09																
Structure's Demolition Cost	Steel Bld. Large	02 41 16.13 0020	0.35	5 /CF					1340				1 CF		1340 CF	
Structure's Vol. Demolished									17				CY	0.35	17 CY	
Rubble's Weight (exclude steel)							1		+	+						+
Truck's Capacity										+	1	+				
Haulage													1			
Transportation Cost Non Steel Truck			1			1	1		+			+	_			
Disposal Cost Non Steel Drive				Ī								-				
Steel's Weight																
Truck's Capacity																
Haulage																
Transportation Cost Steel Truck									-							
Transportation Cost Steel Truck Drive																
Disposal Cost Steel							1								17 CY	
Subtotal		CATALOG CONTRACTOR OF THE PARTY	Secretary of		Service Billion	STATE OF THE STATE OF	The second second									
Equipment's Disposal Cost																
Dismantling Cost							1									
Equipment 's Vol. Demolished																
Loading Costs																
Transport Costs																
Disposal Costs																
Subtotal				The state of the s				The second second				The second second	C. C. C. C. C. C.	W. 1917 1918	- CONTRACTOR OF	
												+				
Floor's Demolition	Complete demonstrated dump	03 05 05 10 0060	13.1	\C\	17	17	0.5						FT		145 CY	
Demontrol Cost	Conciete dellio/ load/ dulip	000000000000000000000000000000000000000	2				000							13	180 0	
Floor's vol. Demolished	VO 6 robool book toon 3		+	\J.								+		2	2	
Loadilly Cost	49 CV (46 Ton) Dump Trick 1/2 mi and trip	is is		>			  -									
Disease Cost	On after disposal	002 41 18 17 4200	10.0	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\											189 CY	
Disposal Costs	Oil site disposal	02 41 10.11 4200														
COLOCAL																
Floor's Demolition																-
Demolition Cost																
Floor's Vol. Demolished																
Loading Cost																
Transportation Cost																+
Disposal Costs																
Subtotal				Section 1						Service Service	Charles and the control of	No. of the last	A STATE OF THE STA			
Foundation's Demolition																
Demolition Cost	Concrete demo/ load/ dump	03 05 05.10 0060	13.1	1 /CY					4				CY		4 CY	
Foundation's Vol. Demolished														1.3	5 CY	
Loading Cost	Front end loader 3 CY			/CY												
Transportation Cost	12 CY (16 Ton) Dump Truck 1/2 mi. rnd. trip	trip		/CY												
Disposal Costs	On site disposal	02 41 16.17 4200	10.3	2 /CY											5 CY	
Subtotal																1
			_	_			_									
					-											

Page 10 of 13 Diesel09



Revised January 2013

Pipelines10 Page 11 of 13

Revised January 2013

Page 12 of 13 SlurryFeedTankandPump11



A				-			l	l	ſ			ı	-	1				ı		
Formation of the control of the cont	Jo.		Matenals	Means									Density	ıme						Cost
For Continuous   For				Number	Cost												actor			
A   A   A   A   A   A   A   A   A   A		Foundations12						-		_									l	
Figure 1 and the control of the cont		Structure's Demolition Cost																		
Marked   M		Structure's Vol. Demolished																		
At Sear Track  At Sea		Rubble's Weight (exclude steel)																		
A		Truck's Capacity																		
State   Truck   State   Truc		Haulage																		
Size   Trock   Character   C		Transportation Cost Non Steel Truck																		
Sheet   Lack She		Transportation Cost Non Steel Drive																		
State   Track   Track   Stat		Disposal Cost Non Steel																		
State   Track		Steel's Weight																-		
Part State   Track Drave         Part State		Truck's Capacity																		
See   Truck   Prince		Haulage																		
State   Truck Denote   State		Transportation Cost Steel Truck																		
Demoished  Demoished  To value disposal  To value d		Transportation Cost Steel Truck Drive														T				
Demoished    Controlled   Contr		Disposal Cost Steel														T			l	
Demoished  To said track removal  Tell and track remov		Subtotal										A STATE OF THE PARTY OF THE PAR								
Demoished    Foundation demoi load' damp   C2 41 61 70 0440   8 056 CY   30 40 10   6 22																				
Demoished   Demo		Equipment 's Disposal Cost																		
Permolished		Dismantling Cost																		
Controlled control coact dump   C2 + 1 6 + 7 0 440   C2 + 1 6 + 1 6 +		Equipment's Vol. Demolished																		
Foundation denot load dump (2,4116,17,044) 8.05 CV 30, 40, 10 444  Foundation demot load dump (2,4116,17,044) 8.05 CV 10 10 6 22  Foundation demot load dump (2,4116,17,044) 8.05 CV 10 10 6 22  Foundation demot load dump (2,4116,17,044) 8.05 CV 10 10 6 31 706  Inches and track removal (2,4116,17,044) 10.2 LF. 200  Inches and track removal (2,4113,33,350) 11.2 LF. 200  Inches and track removal (3,4116,17,044) 11.3 Since disposal (3,4116,17,044) 11.3 Since disp		Loading Costs																		
Exercision genrol load (gamp)   12 41 16 17 0440   8 0.6 CV   30   40   10   444   10		Transport Costs																		
Foundation demoi load'd dump   C2 41 16 17 0440   8.05  CV   30   40   10   444		Disposal Costs																		
Foundation demot load dump   D2 411617 0440   8 05 CY   10   10   444		Subtotal										1000							7	
Foundation demo/ load/ dump   22 41 6.17 0440   8.05  CV   30   40   10   6   22   10   10   10   10   10   10   10																				
Foundation demot load (ump   02 41 16.17 0440   8.05   CY   130   15   15   15   15   15   15   15   1		Concrete Demolition																		
Foundation demoi load dump   02 41 16.17 0440   8 06 1CY   30   16   6   220			Foundation demo/ load/ dump	02 41 16.17 0440	8.05		30	40	10	1	+	444				C			1	3574
Foundation demoi load dump   02.41 f6.17 0440   8.06 fCY   30   15   15			Foundation demo/ load/ dump	02 41 16.17 0440	8.05		10	10	9			22				C				177
ost         On site disposal         02.41 16.17 4200         10.2 /CY         70         65         31           emoval         Tie and track removal         02.41 13.33 3500         12.2 L.F.         200           ost         100         12.2 L.F.         12.2 L.F.         12.2 L.F.           ost         100         12.2 L.F.         12.2 L.F.         12.2 L.F.           ost         100         12.2 L.F.         12.2 L.F.         12.2 L.F.           ost         12.2 L.F.         12.2 L.F.         12.2 L.F.         12.2 L.F.			Foundation demo/ load/ dump	02 41 16.17 0440	8.05		30	15	15			250				C				2013
On site disposal   O2 41 16.17 4200   10.2   CY   70   65   31		Transportation Cost																		
ost ton track removal 02 41 13.33 3500 12.2 L.F. sold track removal 02 41 13.33 3500 12.2 L.F. sold track removal ton ton set to the track removal track removal to the track removal tr		Disposal Costs	On site disposal	02 41 16.17 4200	10.2	/CY	20	99	31			716				C				7303
ost Tie and track removal 02 41 13 33 3500 12 2 L.F. from took 12 2 L.F. from took 12 2 L.F. from the sheet ost 12 2 L.F. from the sheet 12 L.F. from the sheet 12 2 L.F. from the sheet 12 L.F. from the		Subtotal						The second second	The second secon	100	Control of the last			100000000000000000000000000000000000000	**					
ost  lite and track removal  ost  lite and track removal  ost  lite and track removal  ost																T				
Demoliton Cost   Demoliton Cost   Demoliton Cost   Demoliton Cost   Disposation Cost   Disposation Cost   Disposation Cost   Disposation Cost   Disposation Cost   Demoliton Cost   Disposation Cost		E E	Tie and track removal	02 41 13.33 3500	12.2	_	200									Ť			+	2440
Loading Cost         Loading Cost           Dispeased Costs         Promote an Cost           Subtoral Concrete Demolition         Promote an Cost           Concrete Demolition Cost         Promote an Cost           Contracted Demolition Cost         Promote an Cost           Contracted Demolition Cost         Promote an Cost           Contracted Demolition Cost         Promote an Cost           Instruction Cost         Promote an Cost           Ins		Demolition Cost						+	+		+	-	-			T			1	
Transportation Cost		tao) paipao						$\dagger$	+	+	+	+				T				
Display Cooks   Display Cook		Transportation Cost				ſ			-			+				T	İ	t	t	
Subtotal         Concrete Demoilton           Concrete Demoilton         Concrete Demoilton           Concrete Demoilton         Cost           Concrete Demoilton Cost         Concrete Demoilton           Intersportation Cost         Concrete Demoilton           Intersportation Cost         Concrete Demoilton           Subtotal         Cost           Total         Total		Disposal Costs														Ī			l	
Concrete Demolition   Concrete Demolition   Concrete Demolition   Concrete Demolition   Concrete Demolition   Concrete		Subtotal																		
Concrete Demolitor         Concrete Demolitor           Demolitor Cost         Concrete Demolished           Concrete Demolished         Concrete Demolished           Loading Cost         Leading Cost           Tensposal Costs         Concrete Demolished           Sublocal         Costs           Sublocal         Costs           Total         Total																				
Demoiting Cost         Operation		Concrete Demolition																		
Concrete's Val. Demolished   Concrete's Val		Demolition Cost																		
Loading Octat   Loading Cost   Loa		Concrete's Vol. Demolished																		
Transportation Cost		Loading Cost																		
Disposa Costs Subtotal Total		Transportation Cost																		
Subtotal Total		Disposal Costs								+										
Total		Subtotal	No. of the Parish of the Paris	Section of the sectio	Annual Control of	No of the last		Server Se	No. of Contract of	The second			To the second	The second	Control of the last	Contract of the				
logal		1-1-1																		15507
		I otal		THE PERSON NAMED IN COLUMN	A STATE OF THE PARTY OF THE PAR			-		-										2001

Page 13 of 13 Printed 1/29/2013

## EARTHWORK



	Cost	269	3285	299	1807728	4539	17112	2270	0	20905	22940	4594	0	190547				2074188
	Units						_											
Equip. + Labor	Time/Dis.																	
	Units															_		
Production	Rate																	
	Units																	
	Quantity																	
	Units																	П
Total Eq. & Lab.	Costs																	
Number of Men	or Eq.																	
Hourly	Cost																	
Operator's Hourly	Wage Rate																	
Equipment											-							
Hourly	, ,																	
Equipment	_																	
		Plant Sediment Pond 001	Road Pond 002	Heat Dryer Pond 003	Upper and Lower Refuse Basin 004	Grade Upper Refuse Dike 005	Grade Crest 006	Grade Diverson Ditch 007	Cover River Pump House 008	Grade Topsoil Вогтом Area 009	Rip Topsoil Borrow Area 010	Grade Coal Fines Plant 011	Coal Fine Plant Site 012	Support 013				Total

Page 1 of 14

		Hourly		Operator's		Number	Total						Equip. +		
	Equipment Cost	Operating Costs	Equipment	Hourly Wage Rate	Hourly		Eq. & Lab. Costs	Units	Quantity	Units	Production Rate	Units	Labor Time/Dis.	Units	Cost
lant Sediment Pond 001															
Jozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	1	298.65						0.9 HR	꾸	269
ubtotal	San		The state of the	Section of the section of	Mary Commercial Commer		and Spirit and Spirit	Harris Control	The State of the S	S. C.	N. Action Section 1			The same of	269

PlantSedimentPond001 Page 2 of 14

	Hourly	Hourly		Operator's			Total						Equip. +		
	Equipment	Operating	uipment	Hourly	Hourly		Eq. & Lab.				Production		Labor		
	Cost	Costs	verhead	Wage Rate	Cost	or Eq.	Costs	Units	Quantity	Units	Rate	Units	Time/Dis.	Units	Cost
oad Pond 002															
ozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	-	298.65						11	H	3285
57EP-P (9-47) (2nd2006)	36765	190.65	0.1	57.85	497.35	2	994.7						0	0 HR	0
ubtotal	September 1		The second second			10 May 10			State of other			1000	C. C		3285

Page 3 of 14 RoadPond002

	Hourly Equipment Operating	Hourly Operating	Equipment	Equipment Hourly Mane Rate	Hourly	Number of Men	Total Eq. & Lab.	linite	Ousntity	şici	Production	lnite	Equip. + Labor Time/Dis	atic	tac
	500	2200		080	300	T	2500	2	Second Se			5			500
Heat Dryer Pond ous															
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	1	298.65						-	光	299
657EP-P (9-47) (2nd2006)	36765	190.65	0.1	57.85	497.35	4	1989.4						0	0 HR	0
Subtotal	Berthall St. Co.	が 200mm 1 10mm 1 10m	一 大学	The second second second	Section of the second	Scales and September 1	Children College	Story A smooth		SOLD STATE THOU		Section of the section of	ALTERNATION CO. LANDS	A CONTRACTOR	299

HeatDryerPond003 Page 4 of 14

		Hourly		Operator's	Equip	Number	Total						Equip. +	_
	Equipment	Operating	Equipment	Hourly	Hourly	of Men	Eq. & Lab.				Production			
	Cost	Costs	Overhead	Wage Rate	Cost	or Eq.	Costs	Units	Quantity	Units	Rate	Units	Time/Dis. Units	ts Cost
Upper and Lower Refuse Basin 004														
Cover Upper and Lower Refuse Basin with														
4 feet of Cover														
Portion from Borrow Area E														
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	-	298.65						334.4 HR	.9866
657EP-P (9-47) (2nd2006)	36765	190.65	0.1	57.85	497.35	4	1989.4						334.4 HR	665255
Portion from Borrow Area D+G														
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	-	298.65						95.6 HR	2855
657EP-P (9-47) (2nd2006)	36765	190.65	0.1	57.85	497.35	2	994.7						95.6 HR	36096
Portion from Borrow Area H+I														
Off hwy rear dump 35 T 01 54 33 20 5600	12200	82.6	0.1	66.03	50.83	10	2077.20						241 HR	20060
Front end Loader 988G 475 hp 01 54 33 20 4810	16200	1	0.1	66.03	67.5	2	521.60						241 HR	12570
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	47.5	84.17	-	280.12						241 HR	6750
Portion from Clearwater &														
Lower Refuse Dikes														
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	1	298.65						98.4 HR	29387
657EP-P (9-47) (2nd2006)	36765	190.65	0.1	57.85	497.35	4	1989.4						98.4 HR	19575
Subtotal												300000000000000000000000000000000000000		1807728

		Hourly		Operator's		Number	Total						Equip. +		
		Operating	quipment	Hourly	Hourly	of Men	Eq. & Lab.				Production		Labor		
	Cost	Costs	verhead	Wage Rate	Cost	or Eq.	Costs	Units	Quantity	Units	Rate	Units	Time/Dis.	Units	Cost
Grade Upper Refuse Dike 005															
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	1	298.65						15.2 HR	4	4539
Subtotal	S. Complete Complete		A STATE OF THE STA	Sample Comment	Strains with	Section of the second	Security Committee	The second second			Contract of the Contract of th	No. of Control of Control	Secretary Sections	Sales Andread	4539

GradeUpperRefuseDike005

Page 6 of 14

	Hourly Equipment Operating Cost Costs	Hourly Operating Costs	Equipment Overhead	Operator's Hourly Wage Rate	Hourly	Number of Men or Eq.	Total Eq. & Lab. Costs	Units	Quantity	Units	Production Rate	Units	Equip. + Labor Time/Dis.	Units	Cost
Grade Crest 006 Lower Refuse Pond															
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	1	298.65						57.3 HR	¥	17112
										1				1	
										T				T	
Subtotal	- COLUMN		もことでは、それの大	Table of the second second		The second second		The second second			The second second	A STATE OF THE STA	STATE OF THE STATE	The second second	17112

GradeCrest006 Page 7 of 14

	Equipment Cost	Hourly or Operating Costs	Equipment Overhead	Operator's Hourly Wage Rate	Hourly	Number of Men or Eq.	Total Eq. & Lab. Costs	Units	Quantity	Units	Production Rate	Units	Equip. + Labor Time/Dis.	Units	Cost
Grade Diverson Ditch 007 West of Price River															
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	1	298.65						7.6 HR	¥	2270
0.144.5															0266
Subloial	12.12.12.12.13.13.13.13.13.13.13.13.13.13.13.13.13.	Control of the		The state of the s	The second second			100000000000000000000000000000000000000							7710

GradeDiversonDitch007 Page 8 of 14

	Equipment	Hourly Operating Costs	Equipment Overhead	Operator's Hourly Wage Rate	Hourly	Number of Men or Eq.	Total Eq. & Lab. Costs	Units	Quantity	Units	Production Rate	Units	Equip. + Labor Time/Dis	Units	Cost
Cover River Pump House 008 and Slurry Pipeline Areas with Topsoil															
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	1	298 65							9	
657EP-P (9-47) (2nd2006)	36765	19	0.1	57.85	497.35	2	994.7						0	O HR	
Subtotal	Company of the Party of the Par		100 Co. 100 Co	10 1 (No. of Col.)	Section of the second	519.71									

CoverRiverPumpHouse008

Page 9 of 14

Revised January 2013

Wellington Prep Plant C/007/012

		Hourly		Operator's		_	Total						Equip. +		
	Equipment Operating	Operating	Equipment		Hourly	of Men	Eq. & Lab.	-		:	Production	:	Labor		
	Cost	Costs	Overnead	wage Kate	Cost	$\dashv$	Costs	Units	Quantity	Units	Kate	Units	Time/Dis.	Units	Cost
Grade Topsoil Borrow Area 009															
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	2	597.29						35	35 HR	20905
Subtotal	The Property of the			明報がよりの 大田 別の	Mary Colores	Seal And Street Michigan	Samuel Services	- KINDOWS AND	W-2 8 - 12 - 12 - 12 - 12 - 12 - 12 - 12	# 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	よい なお のまでかりと	ME STATE OF	STATE OF THE STATE	BURNESS BURN	20905

		Hourly		Operator's		Number	Total						Equip. +		
	Equipment	Operating	Equipment	Hourly	Hourly	of Men	Eq. & Lab.				Production		Labor		
	Cost	Costs		Wage Rate	Cost	or Eq.	Costs	Units	Quantity	Units	Rate	Units	Time/Dis.	Units	Cost
Sin Tonsoil Borrow Area 040															
Dozer 410 HP 01 54 33 20 4360	20200	134.95	0.1	66.03	84.17	2	597.29						35	35 HR	20905
Multi-Shank Ripper 360-519 P (9-56) (2nd2006)	3040	9.15	0.1		29.07	2							35	35 HR	2035
Subtotal	Charles and a live			The second second	Address Co. School	Same and the	10 mm 12 7 18 98 20	10 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	of the second		- Contract C	***************************************	The state of the s	Service of the servic	22940

RipTopsoilBorrowArea010

Page 11 of 14

Equipment Cost	Hourly Operating Costs	Equipment Overhead	Operator's Hourly Wage Rate	Hourly Cost	of Men or Eq.	Total Eq. & Lab. Costs	Units	Quantity	Units	Production Rate	Units	Equip. + Labor Time/Dis.	Units	Cost
	29 62	Ġ	20 62	00 00 7		700 00		1000			9	0.00		
0/0	32.03	5	20.70	100.33		100.33		/400 LCY		324	324 LCY/HK	22.8 HK	¥	4294
T							ı							
Γ														
Г														
Г														
Г														
Г														
Г														
П														
П														
П														
П														
														A20A

GradeCoalFinesPlant011

Revised January 2013

		Hourly		Operator's			Total						Equip. +		
	Equipment	ant Operating Eq	uipment	Hourly	Hourly	of Men	Eq. & Lab.			3 1	Production	1	Labor		į
	COSI	COSIS	/ernead	wage Kale	Cost	┱	Costs	OUIIIS	Cuantity	CUITS	кате	OUIES	I ime/UIS.	OUIES	Cost
oal Fine Plant Site 012															
7R Series II (9-50) (2nd2006)	11575	52.85	0.1	57.85	188.33	1	188.33						10	0 HR	0
57EP-P (9-47) (2nd2006)	36765	190.65	0.1	57.85	497.35	1	497.35						0 HR	꾸	0
Subtotal					_										0

CoalFinePlantSite012 Page 13 of 14

Revised January 2013

Equipment   Costs			Hourly		Operator's		Number	Total						Equip. +		
Side to 01 54 33 40 7200		Equipment	Operating Costs		Hourly Wage Rate	Hourly		Eq. & Lab. Costs	Units	Quantity	Units	Production Rate	Units	Labor Time/Dis.	Units	Cost
4 ton 01 54 33 40 7200 660 15.2 0.1 0 0 21.1 1 37.82  68.44 50 hp to pull H2O 01 54 33 40 7600 1325 6.5 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	Support 013				,											
outside course 660 15.2 0.1 0 21.1 1 37.82 coursed fruck 6X4 450 hp to pull H2O 01 54.33 40 7600 34.75 6.99 0.1 66.03 144.79 1 14.48 course frank trailer 01 54.33 40 6900 1325 6.9 0.1 0 5.52 1 79.14 course frank trailer 01 54.33 40 6900 1325 6.9 0.1 course frank trailer 01 54.33 40 6900 1325 6.9 0.1 course frank trailer 01 54.33 40 6900 1325 6.9 course frank trailer 01 54.33 40 6900 1325 6.0 course frank trailer 01 54.33 40 6900 1325 6.0 course frank trailer 01 54.33 40 6900 1325 6.0 course frank trailer 01 54.33 40 6900 1325 6.0 course																
1 HZO water tank trailer 01 54 33 40 7600 3475 63.65 0.1 66.03 144.79 1 144.8	Trick 4X4 3/4 ton 01 54 33 40 7200	099			0	21.1	-	37.82						1006	£	38047
I H2O water tank trailer 01 54 33 40 7600 3475 6.9 0.1 66.03 144 79 1 14.48	Foreman outside					57.97	1	57.97						1006	壬	58318
I H2O water tank trailer 01 54 33 40 6900 1325 6.9 0.1 0 5.52 1 79.14	Tractor/Truck 6X4 450 hp to pull H2O 01 54 33 40 7600	3475	63		66.03	144.79	_	14.48						1006	壬	14567
Strictial  Strictial	5,000 gal H2O water tank trailer 01 54 33 40 6900	1325			0	5.52	-	79.14						1006	HR	79615
Subtotial																
Subtotial																
Subtorial																
Stitutial																
Subricial																
Subtorial																
Subricial																
Subritial																
Subridial																
Subtorial																
Subina																
Subotal																
	Subtotal	S. R. S. L. P. Kollins		The second secon	The state of the state of				State of the state	Contract Contract	-	Same Part of the same	The section of	The second second	S. Arekarine	190547

## REVEGETATION

